

# Part 573 Safety Recall Report

# 22V-595

**Manufacturer Name :** Airstream, Inc.**Submission Date :** SEP 21, 2022**NHTSA Recall No. :** 22V-595**Manufacturer Recall No. :** NR**Manufacturer Information :**

Manufacturer Name : Airstream, Inc.

Address : 419 West Pike Street  
PO Box 629 Jackson Center OH  
45334-0629

Company phone : 937-596-6111

**Population :**

Number of potentially involved : 2,856

Estimated percentage with defect : 4 %

**Vehicle Information :**

Vehicle 1 : 2021-2022 Airstream Basecamp, Bambi, Atlas, Interstate, Interstate 19

Vehicle Type :

Body Style : OTHER

Power Train : NR

**Descriptive Information :** The supplier Dometic Corp indicated that the scope date(s) are from August 2020, through June 2021. Airstream used that information to set our recall scope. On May 19, 2022, Dometic Corp indicated that the scope dates have increased. The scope date is now August 2020 through May 12, 2022.

**Production Dates :** MAR 22, 2021 - DEC 29, 2021

VIN Range 1 : Begin : 1SMG4DC10MJ205412 End : 1SMG4DD2XNJ206706

 Not sequential

VIN Range 2 : Begin : 1STCMAA10MJ557099 End : 1STVMAF1XNJ560983

 Not sequential

VIN Range 3 : Begin : 1B9GUWA20MJ306791 End : 1B9KUWH2XNJ309425

 Not sequential**Description of Defect :**

**Description of the Defect :** Per Dometic Recall 22E021; "The burner control valve, mated directly to the control knob via the valve stem, on the cooktop may leak gas."

FMVSS 1 : NR

FMVSS 2 : NR

**Description of the Safety Risk :** Per Dometic Recall 22E021, "There is an increased risk of fire and injury. The detailed description of the potential safety-related defect is associated with the burner control valve where the valve stem is located directly behind the cooking knob of the cooktops. There is a potential for the gas leak behind the control knob to ignite and create a small pilot flame and present a possibility of a burn to the user.

**Description of the Cause :** Per Dometic Recall 22E021, the burner control valve may have incurred abrasions, internally or externally, on the mating metal sealing surfaces of the burner control valve that may have led to leaks.

Identification of Any Warning : Per Dometic Recall 22E021, while being used the smell of gas may precede any that can Occur : ignition and presence of flame.

## Involved Components :

Component Name 1 : Dometic Cooktop, Two Burner LPG

Component Description : Dometic Cooktop, Two Burner LPG

Component Part Number : PI8022

## Supplier Identification :

### Component Manufacturer

Name : Dometic Corporation

Address : 5155 Verdant Dr.  
Elkhart Indiana 46516

Country : United States

## Chronology :

On May 12, 2022, Airstream received an email from Dometic stating that on May 3, 2022 Dometic Corporation notified NHTSA that a safety defect exists in certain 2-burner Cooktops, model numbers CE99-ZF and PI8022. Specifically, the burner control valves may become damaged, causing a gas leak. On May 14, 2022 we began the process of identifying the affected units. 8/5/2022 - Due to lack of documentation of the cooktop serial numbers, it was decided that Airstream would broaden the affected unit population in an effort to capture the units produced with the affected cooktops and include an inspection process as part of the recall remedy. Airstream will be submitting a 573 to begin the recall process.

## Description of Remedy :

Description of Remedy Program : Dealers will be instructed to perform an inspection of the cooktops. If the cooktop is not part of the affected units, no further action is required. If the cooktop is part of the affected units, Airstream will provide all parts and labor free of charge to Consumers and Dealers. An authorized Airstream dealer will need to perform the remedy and replace the cooktop. The Model and Serial Number are required to be logged on the claim, and will be needed when contacting Dometic to order the replacement cooktop. Upon receiving the cooktop, the remedy instructions will be provided as well as a recall response card that must be filled out and sent back to Dometic as stated in their instructions.

How Remedy Component Differs from Recalled Component : Per Dometic Recall 22E021, The replacement/exchange unit will have a completely different serial number outside of the recall population that will not have the defective burner control valve. The units will be visually the same to the end user.

Identify How/When Recall Condition was Corrected in Production : Per Dometic Recall 22E021, Burner control valves from the supplier are no longer in use at the manufacturing site. The supplier only provided a limited production run because of production volume challenges.

## Recall Schedule :

Description of Recall Schedule : Airstream will send dealer and owner notification letters once approved by NHTSA.

Planned Dealer Notification Date : OCT 07, 2022 - OCT 07, 2022

Planned Owner Notification Date : OCT 07, 2022 - OCT 07, 2022

\* NR - Not Reported