OMB Control No.: 2127-0004

Part 573 Safety Recall Report

22V-599

Manufacturer Name: Shyft Group
Submission Date: AUG 08, 2022
NHTSA Recall No.: 22V-599
Manufacturer Recall No.: 22-05



Manufacturer Information:

Manufacturer Name: Shyft Group

Address: 1541 Reynolds Road

Charlotte MI 48813

Company phone: 517-543-6400

Population:

 $\begin{array}{ll} \text{Number of potentially involved:} & 38 \\ \text{Estimated percentage with defect:} & 100 \,\% \\ \end{array}$

Vehicle Information:

Vehicle 1: 2023-2023 Spartan RV Chassis K2 Vehicle Type: BUSES, MEDIUM & HEAVY VEHICLES

Body Style: UNKNOWN Power Train: DIESEL

Descriptive Information: Motorhome chassis subject to this recall are equipped with engines that are subject to

Cummins recall 22E-063. Cummins supplied Engine Serial Numbers that were traced

to the affected chassis VIN's.

Production Dates: JUN 02, 2022 - AUG 02, 2022

Description of Defect:

Description of the Defect: According to Cummins Engine Control Modules within the subject population

that are affected by the defect condition may develop an internal electrical short circuit, possibly resulting in an enginestall without warning. If this occurs, the engine cannot be restarted untilreplacement of the ECM and, if

necessary, the fuse.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: An unexpected engine stall without the ability to restart the engine may lead

to an increased risk of a crash.

Description of the Cause: A screw in the supplier's selective solder fixture backed out of position,

pushing an electrolytic capacitor frame into the Printed Circuit Board (PCB)

during ECM production.

Identification of Any Warning This can occur without warning.

that can Occur:

Involved Components:

Component Name 1: Electronic, Control Module

Component Description: Engine Control Module

Component Part Number: NR

Supplier Identification:

Component Manufacturer

Name: Vitesco

Address: 2400 Executive Hills Blvd

Auburn Hills Michigan 48326

Country: United States

Chronology:

On August 4, 2022, Cummins notified Shyft of recall 22E-063 and provided Engine Serial Numbers (ESNs) of the affected engines. Shyft traced the ESN's to Vehicle Identification Numbers (VINs) to identify the affected motor home chassis. On August 5, 2022 a Stop Ship was put into place for chassis still in Shyft's position. That same day, Shyft determine a defect relating to motor vehicle safety could exist in the affected motorhome chassis.

Description of Remedy:

Description of Remedy Program: The affected motorhome chassis are still within their warranty period and

would not be subject to reimbursement.

How Remedy Component Differs Cummins has not provided that information.

from Recalled Component:

Identify How/When Recall Condition Chassis are currently being held until the remedy is applied.

was Corrected in Production:

Recall Schedule:

Description of Recall Schedule: At this time, it does not appear motorhomes built on the affected chassis

have been sold to retail owners. The planned owner notification date is the date to notify the affected final stage manufacturers. Also, Shyft does

not have dealers for the chassis.

Part 573 Safety Recall Report

22V-599

Page 3

Planned Dealer Notification Date: NR - NR

Planned Owner Notification Date : AUG 10, 2022 - AUG 10, 2022

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR §573