OMB Control No.: 2127-0004

Part 573 Safety Recall Report

22V-611

Manufacturer Name: Thor Motor Coach
Submission Date: AUG 10, 2022
NHTSA Recall No.: 22V-611

Manufacturer Recall No.: NR



Manufacturer Information:

Population:

Manufacturer Name: Thor Motor Coach

Address: PO Box 1486

Number of potentially involved: 262 Estimated percentage with defect: 100 %

701 County Road 15 Elkhart IN 46515

Company phone: 877-500-1020

Vehicle Information:

Vehicle 1: 2022-2023 Thor Motor Coach Four Winds

Vehicle Type: BUSES, MEDIUM & HEAVY VEHICLES

Body Style : OTHER Power Train : GAS

Descriptive Information: Notice from vendor of defective welded seam on awning

Production Dates: FEB 28, 2022 - MAY 25, 2022

VIN Range 1: Begin: 1FDXE4FN0NDC38386 End: 1FDXE4FNXNDC38380 ✓ Not sequential

Vehicle 2: 2022-2023 Thor Motor Coach Quantum Vehicle Type: BUSES, MEDIUM & HEAVY VEHICLES

Body Style : OTHER Power Train : GAS

Descriptive Information: Notice from vendor of defective welded seam on awning

Production Dates: FEB 24, 2022 - JUN 23, 2022

VIN Range 1: Begin: 1FDXE4FN0NDC12628 End: W1X8E33YXNN189323 ✓ Not sequential

Vehicle 3: 2022-2022 Thor Motor Coach Geneva Vehicle Type: BUSES, MEDIUM & HEAVY VEHICLES

Body Style : OTHER Power Train : GAS

Descriptive Information: Notice from vendor of defective welded seam on awning

Production Dates: MAR 18, 2022 - APR 21, 2022

VIN Range 1 : Begin : 1FDXE4FN0NDC43362 End : 1FDXE4FN9NDC43361 ✓ Not sequential

Vehicle 4: 2022-2023 Thor Motor Coach Chateau

Vehicle Type : Body Style : Power Train : NR

Descriptive Information: Notice from vendor of defective welded seam on awning

Production Dates: FEB 22, 2022 - MAY 24, 2022

VIN Range 1: Begin: 1FDXE4FN3NDC33747 End: 1FDXE4FNXNDC36841 ✓ Not sequential

Description of Defect:

Description of the Defect: These vehicles may be equipped with a Lippert awning that has the possibility

of the welded seam on the fabric to separate, potentially allowing the awning to

drop beyond normal operation.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: If the awning drops beyond normal operation it can increase the risk of

injury.

Description of the Cause : Insufficient weld penetration in some areas between the fabric and the

adjoining PVC track.

Identification of Any Warning Visibly seeing at partial weld separation at the ends of the awning roll along the

that can Occur: coach.

Involved Components:

Component Name 1: AWNROLL-16' BLKSOLID

Component Description: AWNROLL-16' BLKSOLID

Component Part Number: 0298484

Component Name 2: AWNROLL-14' BLKSOLID

Component Description: AWNROLL-14' BLKSOLID

Component Part Number: 0298482

Supplier Identification:

Component Manufacturer

Name: Lippert

Address: PO Box 2888

Elkhart Indiana 46515

Country: United States

Chronology:

7/19/2022 – TMC was notified by Lippert that they were recalling awning fabric and TMC had units that were involved in that recall.

7/25/2022 – Shipping information provided used to get a final scope for the recall population.

8/10/2022 - Safety committee was notified and voted to issue a recall.

Description of Remedy:

Description of Remedy Program: Repair or replace the awning. TMC will provide reimbursement based on

general reimbursement plan on file with NHTSA

How Remedy Component Differs The new fabric provided by Lippert was produced after 6/20/2022

from Recalled Component:

Identify How/When Recall Condition Supplier corrected

was Corrected in Production:

Recall Schedule:

Description of Recall Schedule: TMC will notify the dealers and owners of the recreational vehicles by

letter. A final copy of the owner letter will be provided to NHTSA, along

with the dealer repair procedures.

Planned Dealer Notification Date: SEP 08, 2022 - SEP 08, 2022

Planned Owner Notification Date: SEP 08, 2022 - SEP 08, 2022

^{*} NR - Not Reported