

WRG-22 / SSLP VEHICLES ONLY

APPLICABILITY: 2017-19MY Impreza / Halogen Head Lamps

NUMBER: WRG-22

SUBJECT: Halogen Headlamp Low Beam & Side Reflector

DATE: 9/30/2022

INTRODUCTION:

This bulletin announces the design change made to the halogen headlamp assemblies. It has been discovered that the front halogen headlamp assemblies, containing the side reflex reflector and low beam reflector, may not fully meet requirements set forth in Federal Motor Vehicle Safety Standard 108 (VMVSS 108). At certain viewing angles, the left and right front side reflectors may not provide sufficient reflective light. Both left and right front halogen low beam reflectors may not properly illuminate the roadway for the driver and can cause glare to oncoming traffic. The new parts have enhanced reflective capabilities and are currently in production.

PART INFORMATION:

REMINDER: Always order the most up-to-date replacement parts based on the specific VIN being repaired.

Part Description	Part Number
LAMP ASSY HEAD A, RIGHT	84001FL00B
LAMP ASSY HEAD A, LEFT	84001FL01B

IMPORTANT: Part numbers **84001FL00B** & **84001FL01B** are on hold and restricted from Partseye, the PIC team will release the ordered parts when contacted with a valid SSLP VIN and order number. Contact must be made within five business days of the order, or it will be canceled.

CAUTION: VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.

Subaru of America, Inc. is ISO 14001 Compliant

ISO 14001 is the international standard for excellence in Environmental Management Systems. Please recycle or dispose of automotive products in a manner that is friendly to our environment and in accordance with all local, state and federal laws and regulations.

WRG-22 / SSLP VEHICLES ONLY

Service Procedure / Information:


REMINDER: Customer satisfaction and retention starts with performing quality repairs.

HEADLAMP REMOVAL:

Remove both left and right halogen headlamp assemblies. Refer to applicable Service Manual: Body & Electrical/WIRING SYSTEM > LIGHTING SYSTEM > Headlamp Assembly > Removal

HEADLAMP INSPECTION:

Locate the part numbers labeled on the both the left and right headlamp assemblies. The part identification label is located on the inner front portion of the headlamp. See the images below.

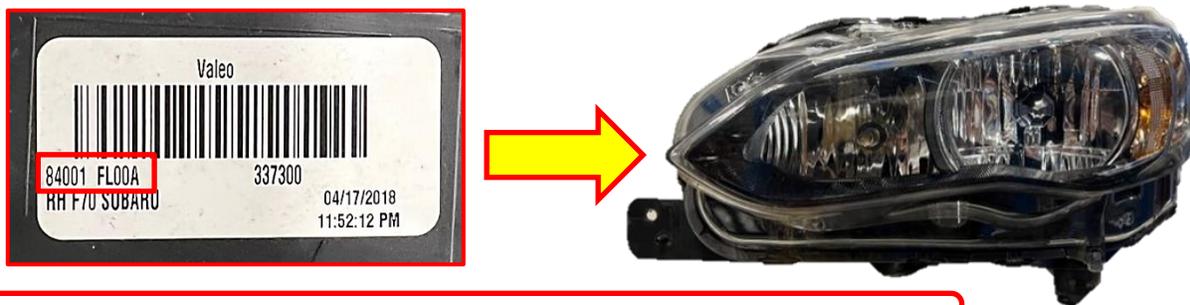

The example part identification label pictured above shows part number **84001FLOOA**

Headlamps with part number **84001FLOOB** or **84001FL01B** will not require replacement and can be reinstalled and adjusted. ALL other part numbers will require replacement and adjustment.

HEADLAMP INSTALLATION & ADJUSTMENT:

Depending on the inspection results, reinstall and / or replace the left and right headlamps. Refer to applicable Service Manual: Body & Electrical/WIRING SYSTEM > LIGHTING SYSTEM > Headlamp Assembly > Installation & Adjustment

IMPORTANT NOTES:

- Light bulbs will not be fitted in the new headlamp assemblies. If replacement is required, the original bulbs must be transferred to the new headlamp assembly.
- Whenever reconnecting the ground cable terminal to the battery sensor, torque to 7.5Nm (5.5ft.-lbs. or 66inch.-lbs.) while supporting the sensor with the other hand as outlined in the applicable Service Manual under: STARTING/CHARGING SYSTEMS > Battery Sensor.

WRG-22 / SSLP VEHICLES ONLY

Claim Reimbursement and Entry Procedures:

Credit to perform this recall will be based on properly completed repair order information. Retailers may submit claims through Subarunet.com.

Labor Description	Labor Operation #	Labor Time	Fail Code
BOTH HALOGEN HEADLAMP R&R AND ADJUST	A838-588	0.8	WRG-22

IMPORTANT REMINDERS:

- SOA strongly discourages the printing and/or local storage of service information as previously released information and electronic publications may be updated at any time.
- Always check for any open recalls or campaigns anytime a vehicle is in for servicing.
- Always refer to STIS for the latest service information before performing any repairs.