

ANB4 - Retrofitting Locking Caps on the Front Left and Right Headlights (Stop Delivery / Recall Campaign)

Model Line: **Cayenne (92A)**

Model Year: **As of 2011 up to 2018**

Country /
Market: **USA (C02)
Canada (C36)**

Concerns: **Locking caps on headlight**

Information: **There is a possibility that a locking cap that prevents the adjustment of the headlights in the horizontal direction was not installed during vehicle assembly on the affected vehicles. If this is the case, certain legal requirements will not be met in the USA and Canada markets.**

Action required: Check installation of the locking caps and retrofit a locking cap on the adjusting screw for the horizontal adjustment on the left and right headlights if necessary.

Affected Vehicles: Only vehicles assigned to the campaign (see also PCSS Vehicle Information).

Installation

Position:



Installation position of caps (e.g. Cayenne MY 2016)

1 – Cap (retrofit)

Required parts

Parts Info:


Required parts:

Part No.	Designation – Location	Number
V04015001KC	⇒ Plug – Headlight adjusting screws	2 pieces

Checking caps and retrofitting them if necessary

Work Procedure: 1 Open front lid.

- 2 Check whether a cap is installed on the adjusting screw for the horizontal adjustment on the left and right headlights. ⇒ *Checking locking caps*

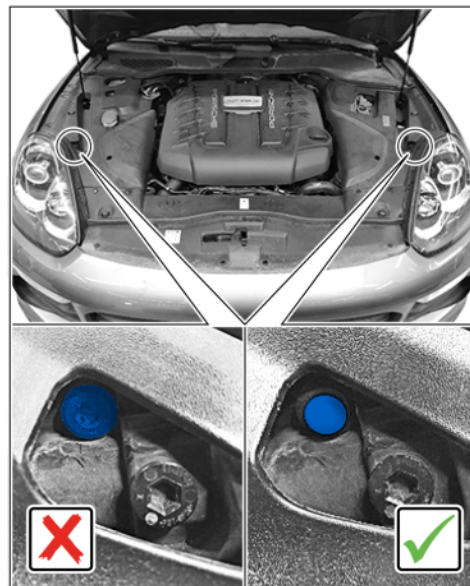

Checking locking caps

Assessment		Action
(✓)	A locking cap is installed on the left and right headlight.	End of remedial action. Continue with Step 4.
(✗)	There is no locking cap or only one cap installed on one headlight .	Retrofit locking cap. Continue with Step 3.

- 3 Press locking cap on the left and right headlight into the adjusting screw ⇒ *Installing locking cap (e.g. left headlight) -1-* for horizontal adjustment.
- 4 Close front lid.
- 5 Enter the campaign in the Warranty and Maintenance booklet.



Installing locking cap (e.g. left headlight)

Warranty processing

Scope 1 - 4: Not relevant for this vehicle type.

Scope 5: **Checking locking caps****Labor time:**

Checking locking caps

Labor time: **12 TU**⇒ **Damage Code ANB4 099 000 1**

Scope 6 - 13: Not relevant for this vehicle type.

Scope 14: **Retrofitting locking caps****Labor time:**

Retrofitting locking caps

Labor time: **14 TU**

Includes: Checking locking caps

Parts required:

V04015001KC Plug

2 pieces

⇒ **Damage Code ANB4 099 000 1**

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2022 Porsche Cars North America, Inc.