

RECALL 22V667 / 2022-499 REMEDY INSTRUCTIONS



Make(s): IMPRESSION
Model(s): MPF280RL & MPF330BH
Model Year(s): 2022 - 2023
Concern:
There may not a secondary means of egress installed in the vehicle as required.

Repair Code: RC-043-03-00-004235
Allotted Time: .25 HRS.
Inspection Code: RC-043-05-00-004234
Allotted Time: .10 HRS.
Photo(s) Required: YES
Prior Authorization Required: YES
Part(s) Kit Number: F100355860
Part(s) Return: NO

Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

INSPECTION:

STEP 1: LOCATE THE REAR 60" X 29" REAR WALL WINDOW;

- IF THE LATCH IS **RED AND THERE IS A "EXIT" STICKER** ON THE GLASS – NO FURTHER ACTION;
- CLAIM INSPECTION CODE ONLY;
- IF THE LATCH IS BLACK AND **MISSING** THE "EXIT" STICKER, MOVE ON TO REMEDY;
- IF THE LATCH IS BLACK AND **HAS** THE "EXIT" STICKER, MOVE ON TO REMEDY;
- IF THE LATCH IS RED AND **MISSING** THE "EXIT" STICKER, MOVE ON TO REMEDY;

REMEDY:

STEP 1: LOCATE THE REAR 60" X 29" REAR WALL WINDOW;

STEP 2: REMOVE THE LATCH;

STEP 3: INSTALL THE RED LATCH FROM THE PARTS KIT;

STEP 4: CLEAN THE GLASS AREA NEXT TO THE LATCH WITH ISOPROPYL ALCOHOL IN A 10" X 10" AREA;

STEP 5: APPLY THE "EXIT" STICKER DIRECTLY TO THE CLEANED GLASS, SEE FIGURE 1;

STEP 6: ENSURE PROPER OPERATION OF THE WINDOW AND LATCH;

STEP 7: TAKE PHOTO'S OF THE REMEDY AND SUBMIT WITH THE REPAIR CODE CLAIM;

NOTE: THIS PROCEDURE HAS NOW MADE THIS 60" X 29" REAR WALL WINDOW THE SECONDARY MEANS OF EGRESS.

FIGURE 1

