

Recall Campaign Bulletin



Mercedes-Benz

Campaign No. 2022090011, November 2022

TO: ALL MERCEDES-BENZ CENTERS

SUBJECT: **Model C-Class Sedan (206 platform)**
Model Year 2022

Retrofit a Cover for the Rear SAM

Mercedes-Benz AG (“MBAG”), the manufacturer of Mercedes-Benz vehicles, has determined that in the event of water ingress into a particular section of the trunk in certain Model Year (“MY”) 2022 C-Class Sedan (206 platform) vehicles, moisture might enter into the rear signal acquisition and actuation module (SAM). In this case, a short circuit might occur in the rear SAM. In this connection, a risk of fire cannot be completely ruled out. Additionally, a short circuit could lead to various malfunctions. Among others, the exterior lighting at the rear of the vehicle might fail, the rear seatbacks might fold unintentionally, and the rearview camera might not be available. Thus, the risk of a crash or injury could be increased. When the issue occurs, depending on the affected function, a respective warning message would be shown in the instrument cluster. An authorized Mercedes-Benz dealer will retrofit a cover over the rear SAM on the affected vehicles.

Prior to performing this Campaign:

- **VMI must always be checked before performing campaigns to verify that the campaign is required on a specific vehicle. Always check for any other open campaigns, and perform accordingly.**
- Please review the entire Campaign bulletin and follow the repair procedure exactly as described.

Approximately 6,752 vehicles are affected.

Order No. P-RC-2022090011

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.

Recall Campaign Bulletin

Recall Campaign Bulletin

Recall Campaign Bulletin

Recall Campaign Bulletin

Recall Campaign Bulletin

Retrofit felt in rear right of trunk

Work Procedure

1. Loosen rear right trunk lining and fold inward.
2. Retrofit felt (A, figure 1)
 - i** To do this, dispose of the 2 clips from the new felt and attach two cable ties (B, figure 1) to both electric lines.
 - i** The grey smooth side has to face against the control unit.

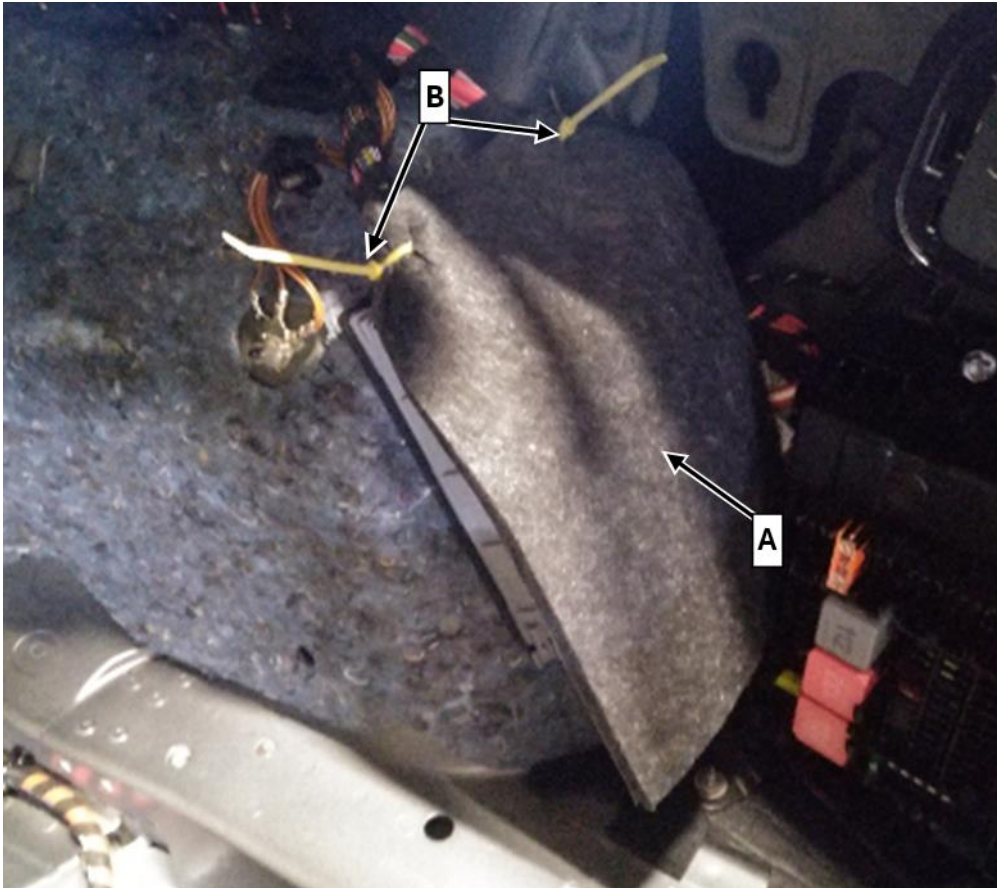


Figure 1

3. Shorten protrusion of the cable tie.
 4. Assemble in reverse order.
-

Primary Parts Information

Qty.	Part Name	Part Number
1	Felt carpet	A 213 692 00 01
2	Cable tie	A 006 997 35 90

i Small parts such as screws, lock nuts, sealing rings, cable ties, fluids, sealant, etc. are not listed in the parts list. The required small parts are taken into account in the budgeting.

i **Note:** *The following allowable labor operation should be used when submitting a warranty claim for this repair.*

Warranty Information

Damage Code	Operation Number	Description	Labor Time (hrs.)
63 910 06	02-0434	Retrofit felt in rear right of trunk	0.6

i **Note:** *Always check ASRA for the current OP-Code times. Labor times are subject to change and updates may not be reflected in this document.*