

Connecting Rod Failures Outside of Original 21V-281 Population

Received Date	Vehicle Build Date	Model	Inspection Results
Jan 2021	Aug 2018	HX	CYL3 SE chunked & spun/Bearing spun and damaged/Rod fractured.
Mar 2021	Mar 2019	HX	CYL 5 SE Chunked / Bearing spun
Apr 2021	Aug 2018	HV	CYL 4 SE chunked
Aug 2021	Dec 2018	HV	CYL 2 SE chunked/ Bearing spun. CYL 4,6 SE cracked
Aug 2021	Feb 2019	HV	CYL 2 SE chunked/ Liner scored. CYL 6 SE chunked
Sep 2021	May 2018	HV	SE chunk missing cyl 6
Sep 2021	Aug 2018	HV	CYL 3 SE Chunked/ Bearing spun/ Rod fractured
Dec 2021	Apr 2019	HV	CYL 5 SE chunked./ Bearing spun
Apr 2022	Jun 2019	HV	CYL 1 SE Chunked, CYL 3,4 SE Cracked
Apr 2022	Oct 2019	HV	CYL 4 Ventilated. CYL 2 SE bushing cracked/ Bearing polished
Aug 2022	Dec 2018	HV	CYL 2 SE Chunked, CYL 3,6 SE Cracked
Sep 2019	Oct 2017	RH	CYL 6 SE chunked/Bearing scored to copper/Rod fractured
Oct 2019	Aug 2017	RH	CYL 4 SE Chunked/Bearing spun to copper/Rod fractured
Mar 2020	Mar 2018	RH	Cyl 4 SE Chunked / Bearing spun
Apr 2020	Jun 2017	LT	SE chunk missing cyl 6
Apr 2020	Aug 2017	LT	SE chunk missing cyl 5
May 2020	Feb 2018	RH	SE stripping on Cyl 1, 5
May 2020	Aug 2017	RH	CYL5 SE chunked/ Bearing spun
Jun 2020	Feb 2018	LT	SE chunk missing cyl 2
Dec 2020	Oct 2017	RH	CYL4 SE chunked/ Bearing spun/Rod fractured
Feb 2021	Jan 2018	LT	Cyl 4 SE Chunked / Bearing spun
Feb 2021	Nov 2017	LT	CYL 5 SE chunked/ Bearing spun/ Rod fractured.
Mar 2021	Jan 2018	LT	CYL 2 SE chunked
Mar 2021	Jan 2018	LT	CYL 5 SE Chunked / Bearing spun / Rod fractured
Mar 2021	Feb 2018	LT	CYL 6 SE Chunked, Rod Fractured
Mar 2021	Jan 2018	RH	CYL 6 SE Chunked / Rod fractured
Mar 2021	Nov 2017	RH	CYL3 SE chunked/ bearing damaged to copper/Rod fractured
Apr 2021	Jan 2018	LT	CYL 4 SE Chunked, CYL 1 & 3 SE Cracked
Apr 2021	Sep 2017	LT	CYL 2, 5 SE Chunked, CYL 1, 3, 6 SE Cracked
Apr 2021	Nov 2017	LT	CYL 3 SE chunked
Apr 2021	May 2018	RH	SE chunked cyl #3 / SE cracks cyl #4 & 6
May 2021	Jan 2018	LT	CYL 2 & 6 SE Chunked, CYL 3 SE Cracked
Jun 2021	Feb 2018	LT	CYL 1 SE chunked
Dec 2021	Jun 2017	LT	CYL 4,5,6 SE Chunked, CYL 4,5,6 Bearing side loading
Apr 2022	Feb 2018	LT	CYL 3 SE chunked
Jul 2022	Sep 2017	LT	CYL 1,2,4,5 SE Cracked, CYL 6 SE Chunked
Aug 2022	Nov 2017	LT	CYL 3 SE chunked
Aug 2022	Jul 2017	LT	CYL 2 SE chunked
Aug 2022	Aug 2017	LT	CYL 4,6 SE Chunked