


RECALL 22V694 / 2022-526 REMEDY INSTRUCTIONS

	Make(s): FREELANDER, PRISM & LEPRECHAUN Model(s): MANY, SEE BELOW Model Year(s): 2022 - 2023	Repair Code: RC-026-15-00-004237 Allotted Time: .10 HRS. Inspection Code: RC-026-05-00-004236 Allotted Time: .30 HRS.
	Concern: The auxiliary LPG quick disconnect may leak LPG gas.	Photo(s) Required: NO Prior Authorization Required: YES Part(s) Kit Number: N/A Part(s) Return: N/A

Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

- CERTAIN: 2022 – FREELANDER – FLC22XGC3500, FLC22XGF35, FLC27QBC3500 & FLC27QBF35
 CERTAIN: 2022 – LEPRECHAUN – LPC260DSF, LPC270QBF35 & LPC319MBF
 CERTAIN: 2023 – FREELANDER – FLC21RSF35, FLC21RSF45, FLC22XGF35, FLC23FSF35, FLC23FSF45, FLC23QBC3500, FLC26DSF45, FLC27QBC3500, FLC27QBF35, FLC27QBF45, FLC29KBF45 & FLC31FSF45
 CERTAIN: 2023 – LEPRECHAUN – LPC210RSF35, LPC220XGF45, LPC260DSF, LPC270QBC350, LPC271QBFEM9, LPC298KBF & LPC311FSF
 CERTAIN: 2023 – PRISM – PRC2150CB

INSPECTION:

- STEP 1: LOCATE THE LPG QUICK DISCONNECT ON THE PASSENGER SIDE, REAR OF THE VEHICLE;
- IF THE LPG FITTING CAN BE MANIPULATED BY HAND (LOOSENED OR TIGHTENED) MOVE ON TO REMEDY;
 - IF THE LPG FITTING IS TIGHT BY HAND, AND TIGHT/SEATED BY WRENCH, CLAIM INSPECTION CODE ONLY;

REMEDY:

- STEP 1: USE THE APPROPRIATE SIZE WRENCH AS A BACKER WRENCH ON THE LINE, WHICH THE LPG QUICK DISCONNECT, THREADS INTO;
- STEP 2: USE THE APPROPRIATE SIZE WRENCH ON THE BODY OF THE LPG QUICK DISCONNECT AND TIGHTEN ACCORDING TO THE BELOW OUTLINES/EXAMPLES:
- TIGHTEN THE QUICK DISCONNECT:
 - IF YELLOW TEFLON TAPE IS PRESENT: 2 FULL TURNS
 - ORIENT THE LEVER PARALLEL WITH THE GROUND
 - IF LP GAS THREAD SEALANT IS PRESENT: 1 FULL TURN
 - ORIENT THE LEVER PARALLEL WITH THE GROUND
- STEP 3: **REQUIRED**: PERFORM THREE (3) MINUTE LPG TEST AT 8" WATER COLUMN WITH A MANOMETER.
- **IMPORTANT NOTICE**: IF A LEAK IS DETECTED OUTSIDE OF THE QUICK DISCONNECT, THESE ARE REQUIRED TO BE CLAIMED UNDER A SEPARATE LABOR LINE AS THESE ARE NOT A PART OF THE RECALL.
- STEP 4: CLAIM REPAIR CODE FOR REMEDY.