OMB Control No.: 2127-0004

# Part 573 Safety Recall Report

## 22V-718

**Manufacturer Name:** Volkswagen Group of America, Inc.

NHTSA Recall No.: 22V-718

Manufacturer Recall No.: 47T2



#### **Manufacturer Information:**

Manufacturer Name: Volkswagen Group of America, Inc.

Address: 3800 Hamlin Road

Auburn Hills MI 48326

Company phone: 1-800-893-5298

## **Population:**

Number of potentially involved: 532 Estimated percentage with defect: 1 %

#### **Vehicle Information:**

Vehicle 1: 2023-2023 VOLKSWAGEN ATLAS FL

Vehicle Type :
Body Style :
Power Train : NR

Descriptive Information: The recall population was determined by production records.

The recalled products differ from products that were not included in the recall because in a certain production period, vehicles may have been produced with

incorrectly manufactured brake lines.

ATLAS FL count: 326

Production Dates: SEP 01, 2022 - SEP 15, 2022

VIN Range 1: Begin: 1V2LP2CA3PC509595 End: 1V2WP2CA5PC512141 ✓ Not sequential

Vehicle 2: 2023-2023 VOLKSWAGEN ATLAS CROSS SPORT

Vehicle Type : Body Style : Power Train : NR

Descriptive Information: The recall population was determined by production records.

The recalled products differ from products that were not included in the recall because in a certain production period, vehicles may have been produced with

incorrectly manufactured brake lines. ATLAS CROSS SPORT count: 206

Production Dates: SEP 02, 2022 - SEP 15, 2022

VIN Range 1: Begin: 1V2LC2CA7PC204709 End: 1V2DC2CAXPC206071 ✓ Not sequential

#### **Description of Defect:**

Description of the Defect: A brake line may leak at the threaded connections.

FMVSS 1: NR

FMVSS 2: NR

Description of the Safety Risk: Brake fluid leaks can lead to an increase in stopping distance, which may

increase the risk of a crash.

Description of the Cause: Tooling equipment had not been correctly set up after a maintenance

operation.

Identification of Any Warning If a leak is present, the low brake fluid warning light will illuminate in the

that can Occur : instrument panel. After the reservoir of the potentially affected brake circuit is

completely depleted, the brake pedal travel may begin to increase or the pedal

may begin to feel soft.

## **Involved Components:**

Component Name 1: Brake line
Component Description: Brake line

Component Part Number: 3QF.614.723.A

Component Name 2 : Brake line
Component Description : Brake line

Component Part Number: 3QF.614.724.A

Component Name 3: Brake line Component Description: Brake line

Component Part Number: 3QF.614.725.A

Component Name 4: Brake line

Component Description: Brake line

Component Part Number: 3QF.614.726.A

Component Name 5: Brake line

Component Description: Brake line

Component Part Number: 3QF.614.739.A

Component Name 6: Brake line
Component Description: Brake line

Component Part Number: 3QF.614.740.A

#### **Supplier Identification:**

## **Component Manufacturer**

Name: Sanoh America Inc.

Address: 103 Thomas French Drive

Scottsboro Alabama 35769

**Country: United States** 

#### **Chronology:**

September 14, 2022: Volkswagen received internal reports about leaks at brake lines. Analyis started.

September 19, 2022: A stop sale was initiated for the U.S. market.

September 21, 2022: The topic was presented in Volkswagen's Product Safety Committee, and a recall was

decided.

Volkswagen is not aware of any field complaints on this topic, as it was identified internally.

## **Description of Remedy:**

Description of Remedy Program: The affected brake lines on the affected vehicles will be replaced at no cost

to customers. Volkswagen will not offer a reimbursement plan under this

recall.

How Remedy Component Differs The recall remedy component can be distinguished from the recalled

from Recalled Component: component because the remedy component is correctly manufactured.

Identify How/When Recall Condition September 16, 2022: process improvement and additional checks

was Corrected in Production: implemented.

#### **Recall Schedule:**

Description of Recall Schedule: Dealers/owners: On or before November 23, 2022

Planned Dealer Notification Date : NOV 23, 2022 - NOV 23, 2022 Planned Owner Notification Date : NOV 23, 2022 - NOV 23, 2022

\* NR - Not Reported