

RECALL 22V729 / 2022-556 REMEDY INSTRUCTIONS



Make(s): SALEM, WILDWOOD & OZARK
Model(s): MANY, SEE BELOW
Model Year(s): MANY, SEE BELOW

Concern:

A secondary means of strapping to the fresh water tank to the chassis may not have been installed.

Repair Code: RC-672-03-00-004252
Allotted Time: 2.00 HRS.
Inspection Code: RC-672-05-00-004251
Allotted Time: .25 HRS.

Photo(s) Required: YES
Prior Authorization Required: YES
Part(s) Kit Number: F100362078
Part(s) Return: N/A

Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

CERTAIN: 2021 – OZARK - ZKT2700TH, ZKT2700THX, ZKT1660FQ, ZKT1660FQX & ZKT1900THX

CERTAIN: 2021 – 2022 OZARK - ZKT2500TH, ZKT2500THX, ZKT1680BSK, ZKT1680BSKX, ZKT1650BHK, ZKT1650BHKX, ZKT1800QSX, ZKT1800QS & ZKT1900TH

CERTAIN 2021 – 2022 SALEM - SMT178BHSK, SMT178BHSKX, SMT170SSX, SMT170SS, SMT280RT & SMT280RTX

CERTAIN 2021 – 2022 WILDWOOD - WDT178BHSK, WDT178BHSKX, WDT170SSX, WDT170SS, WDT280RT & WDT280RTX

REMEDY PARTS KIT CONTAINS:

- 12 – 3/8" SELF-DRILLING SCREWS
- 3 – 3" X 48" – 14GA. FLAT STOCK

INSPECTION:

STEP 1: LOCATE THE FRESH WATER TANK IN THE UNDERBELLY OF THE VEHICLE;

- REMOVE UNDERBELLY PANEL AND SET ASIDE WITH FASTENERS;
- IF THE HOLDING TANK HAS STRAPS AROUND THE TANK AND CROSS-MEMBERS (FIG. 1) TAKE PHOTOS;
- INSPECT THE FLOATING CROSS-MEMBER AND ENSURE IT HAS TWO FASTENERS ON EACH SIDE (TOTAL OF 4) (FIG. 2);
- REASSEMBLE ANY REMOVED UNDERBELLY;
- SUBMIT PHOTOS WITH CLAIM INSPECTION CODE ONLY.

IF THE INSPECTION DOES NOT REVEAL ANY OF THE ABOVE, MOVE ON TO REMEDY.

REMEDY:

STEP 1: LOCATE THE FRESH WATER TANK IN THE UNDERBELLY OF THE VEHICLE;

- REMOVE UNDERBELLY PANEL AND SET ASIDE WITH FASTENERS;
- MEASURE AND MARK OUT THE FRESH WATER HOLDING TANK INTO THIRDS;

STEP 2: USE THE 3" X 48" – 14GA. FLAT STOCK FROM THE REMEDY KIT (FIG. 3);

- USE THE 3/8" SELF-TAPPING LAGS TO SECURE THE THREE – 3" X 48" – 14GA. FLAT STOCK TO THE BOTTOM OF THE FULL HEIGHT CROSS-MEMBERS, ONE IS BEHIND THE FRESH WATER TANK AND ONE IS IN FRONT OF THE FRESH WATER TANK;
- DO NOT LAG INTO THE FLOATING CROSS-MEMBER AS THE FASTER WILL PENETRATE THE FRESH TANK;

STEP 3: INSPECT AND ENSURE THE FLOATING CROSS-MEMBER HAS A MINIMUM OF TWO (2) 3/8" SELF-TAPPING FASTENERS (FIG. 2), ADD IF MISSING;

STEP 4: RE-ASSEMBLE THE UNDERBELLY PANEL TO THE CHASSIS BEAMS;

STEP 5: CLAIM REPAIR CODE.

PHOTOS ON NEXT PAGE;

RECALL 22V729 / 2022-556 REMEDY INSTRUCTIONS



Make(s): SALEM, WILDWOOD & OZARK
Model(s): MANY, SEE BELOW
Model Year(s): MANY, SEE BELOW

Concern:

A secondary means of strapping to the fresh water tank to the chassis may not have been installed.

Repair Code: RC-672-03-00-004252

Allotted Time: 2.00 HRS.

Inspection Code: RC-672-05-00-004251

Allotted Time: .25 HRS.


Photo(s) Required: YES

Prior Authorization Required: YES

Part(s) Kit Number: F100362078


Part(s) Return: N/A

FIGURE 1

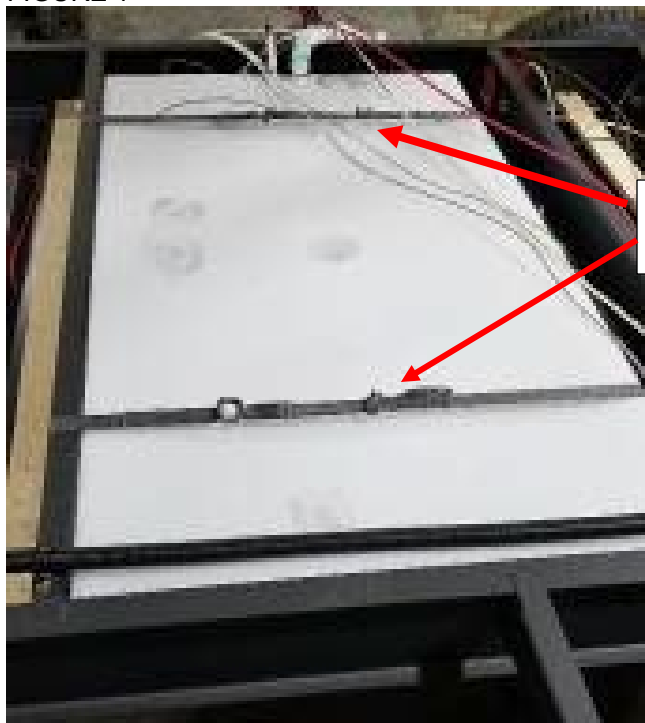

FACTORY INSTALLED 1 1/4" NYLON WEB STRAPPING

FIGURE 2

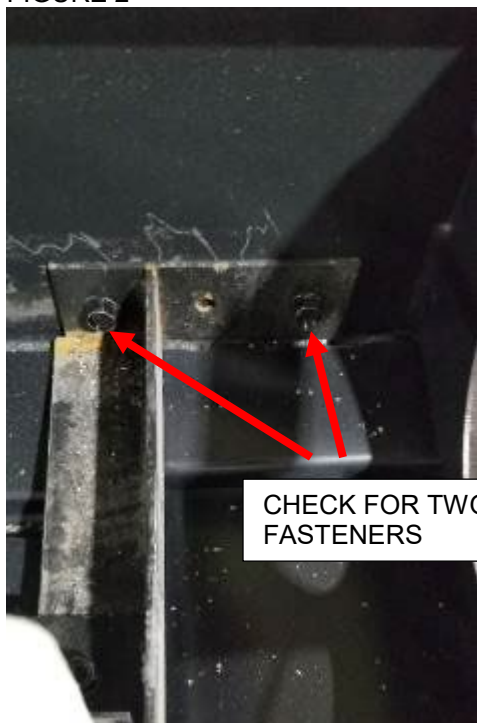

CHECK FOR TWO FASTENERS

FIGURE 3



REMEDY 3" X 48" – 14GA. STRAPS INSTALLED