Part 573 Safety Recall Report

Manufacturer Name :Harley-Davidson Motor CompanySubmission Date :OCT 18, 2022NHTSA Recall No. :22V-781Manufacturer Recall No. :0635



22V-781

Manufacturer Information :

Manufacturer Name :Harley-Davidson Motor CompanyAddress :3700 W. Juneau AvenueMilwaukee WI 53201-0653Milwaukee WI 53201-0653Company phone :(414) 343-4056

Population :

Number of potentially involved : 199,349 Estimated percentage with defect : NR

Vehicle Information :

	2019-2022 Harley-Davidson Trike and CVO Trike (all models) MOTORCYCLES
Body Style :	
Power Train :	
Descriptive Information :	This recall includes a total of 31,554 MY 2019 – 2022 Trike and CVO Trike motorcycles that were manufactured with software that determines if/when the brake lamp(s) should be illuminated. Motorcycles produced after 06/24/2022 are equipped with a new pressure switch and a software calibration update that addresses the potential concern.
Production Dates :	JUL 06, 2018 - JUN 23, 2022
VIN Range 1:	Begin: 1HD1MAF14KB850024 End: 1HD1MCP19NB854018 🖌 Not sequential
Vehicle Type : Body Style :	MOTORCYCLES
Power Train :	
Power Train : Descriptive Information :	GAS This recall includes a total of 167,795 MY 2020 - 2022 Touring and CVO Touring motorcycles that were manufactured with software that determines if/when the brake lamp(s) should be illuminated. Motorcycles produced after 06/24/2022 are equipped with a software calibration update that addresses the potential concern.
Power Train : Descriptive Information : Production Dates :	GAS This recall includes a total of 167,795 MY 2020 - 2022 Touring and CVO Touring motorcycles that were manufactured with software that determines if/when the brake lamp(s) should be illuminated. Motorcycles produced after 06/24/2022 are equipped with a software calibration

Part 573 Safety Recall Report

22V-781

Page 2

Description of Noncompliance :

1	Certain Touring, CVO Touring, Trike and CVO Trike motorcycles may exhibit a condition that can result in the brake lamp(s) remaining illuminated regardless of whether the service brakes are applied. This condition may constitute a non-compliance with FMVSS 108, S7.3.5 and Table 1-c.
FMVSS 1 :	108 - Lamps, reflective devices, and assoc. Equipment
FMVSS 2 :	NR
Description of the Safety Risk :	If the brake lamp(s) remain on, this may increase the risk of a rear end collision by a following vehicle.
Description of the Cause :	Certain motorcycles in the identified population motorcycles may exhibit a condition that may result in the brake lamp(s) remaining illuminated.
ş 8	A rider may detect that the brake lamp(s) is illuminated during the pre-ride
that can Occur :	inspection.

Involved Components :

Component Name 1: NR

Component Description : NR

Component Part Number: NR

Supplier Identification :

Component Manufacturer

Name : NR Address : NR NR Country : NR

Chronology:

6/10/2021 – 10/28/2021 – Harley-Davidson's Technical Subcommittee (TSC) investigated reports of brake lamps remaining illuminated on some MY20 Touring motorcycles. The TSC requested parts back from the field, engaged the suppliers and requested support in the investigation, and enlisted the support of H-D Engineering. Warranty and Customer Contact records were reviewed and analyzed. Based upon the information and data available (including the low frequency of known incidents and the fact that this condition can correct itself based on riding patterns/behavior), the TSC decided to close its investigation.

The information contained in this report was submitted pursuant to 49 CFR §573

5/12/2022 – The TSC reopened its investigation after receiving reports that indicated a higher occurrence rate of this potential issue.

5/13/2022 - 8/24/2022 – The TSC reviewed updated Warranty and Customer Contact records. A software change was implemented at H-D assembly plants that eliminated this potential issue on future production. The TSC elected to monitor this issue monthly.

9/2/2022 - 9/13/2022 - After reviewing field data while in monitor status, the TSC moved this issue back to Active status. An updated search and analysis of warranty and customer contacts data was performed. The TSC escalated this issue to H-D's Field Action Committee (FAC).

9/20/2022 - The FAC reviewed the TSC's findings and analysis and escalated the matter to H-D's Executive Decision Authority (EDA).

9/21/2022 - 10/10/2022 – The EDA met two times to discuss and review the information available. In addition, H-D reached out to NHTSA's Office of Defect Investigation to discuss the circumstances associated with this issue.

10/11/2022 – Based upon the information developed during the investigation, the EDA authorized a voluntary recall to address this condition.

Description of Remedy :

Description of Remedy Program :	Owners of affected motorcycles will be advised to arrange service with an authorized Harley-Davidson dealer, who will perform the remedy at no charge to the customer. Dealers will apply a software update to affected Touring and CVO Touring vehicles. Dealers will apply a software update and install a new pressure switch on affected Trike and CVO Trike vehicles.
	Updated software will address this condition on Touring and CVO Touring models. Updated software and a new pressure switch will address this condition on Trike and CVO Trike models.
	Production motorcycles beginning on 06/24/2022 have been updated and are not subject to the recall condition.

Recall Schedule :

Description of Recall Schedule :	Harley-Davidson will notify the dealer network between $10/21/2022$ and $10/28/2022$. Owner notification letters will be sent between
	10/26/2022 and $11/02/2022$.
Planned Dealer Notification Date :	OCT 21, 2022 - OCT 28, 2022
Planned Owner Notification Date :	OCT 26, 2022 - NOV 02, 2022

The information contained in this report was submitted pursuant to 49 CFR §573

Part 573 Safety Recall Report

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR §573