Part 573 Safety Recall Report

Manufacturer Name :Suburban Manufacturing COSubmission Date :JAN 25, 2023NHTSA Recall No. :23E-002Manufacturer Recall No. :NR

Manufacturer Information :

Manufacturer Name : Suburban Manufacturing CO Address : 676 Broadway Dayton TN 37321 Company phone : 866-645-0658

Equipment Information :

Brand / Trade 1:	Suburban Manufacturing
	SDS2 - 2 Burner Drop In Cooktop
Part No. :	3031 AST & 3032AST
Size :	NR
Function :	NR
Descriptive Information :	The recall production dates includes all production of the SDS2 cooktop to present.
Production Dates :	JAN 16, 2018 - JAN 11, 2023

Description of Defect :

Description of the Defect	: The internal aluminum burner tubes connecting the gas valves to the cook top burners can fracture from excessive vibration or shock experienced through RV travel.
FMVSS 1	: NR
FMVSS 2	: NR
Description of the Safety Risk	: The burner tube could crack resulting a leak of propane when the top burner gas valve is opened to use the appliance. If ignited the propane could result in a fire and/or explosion which could result in personal injury.
Description of the Cause	: The gas manifold at the control knobs can become loose over time due to excessive vibration. With excessive viration the the burner tubes can fail. Lab analysis of failed burner tubes indicate hardening of the aluminum burner tubes likely caused by repeated impact or the excessive vibration.
Identification of Any Warnin that can Occur	 The owner could possibly hear a louder than normal hissing sound or smell propane odor when the cooktop gas valve is turned to the "on" position. The flame height could seem lower than normal. The control knob of the cooktop could appear to be loose and become difficult to operate.



23E-002

Population:

Number of potentially involved : 28,536 Estimated percentage with defect : 100 %

Part 573 Safety Recall Report

Involved Components :

Component Name :Burner TubeComponent Description :Burner Tube - AluminumComponent Part Number :171996

Supplier Identification :

Component Manufacturer

Name : NR Address : NR NR Country : NR

Chronology:

See Attached Chronology.

Description of Remedy :

Description of Remedy Program :	The remedy is still being evaluated at this time.
How Remedy Component Differs from Recalled Component :	
Identify How/When Recall Condition was Corrected in Production :	

Recall Schedule :

Description of Recall Schedule :	As an vehicle equipment supplier, Suburban will notify the purchasers of
	this product by letter when approved by NHTSA.
Planned Dealer Notification Date :	MAR 13, 2023 - MAR 13, 2023
Planned Owner Notification Date :	MAR 13, 2023 ⁻ MAR 13, 2023

Purchaser Information :

The following manufacturers purchased this defective/noncompliant equipment for possible use or installation in new motor vehicles or new items of motor vehicle equipment:

Name : NR Address : NR NR Country : NR Company Phone : NR

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR §573