



New Safety Recall Advanced Communication – 54A

FCA US LLC (FCA US) has announced a safety recall on certain MOPAR service High Voltage (HV) batteries part number 05193168AH intended for use with 2021 - 2023 (JL) Jeep Wrangler Plug-In Hybrid Electric Vehicles (PHEV) vehicles.

REASON FOR THIS SAFETY RECALL

Some of the above MOPAR service batteries may have been manufactured with a 200 amp fuse with an incorrect fastener. An incorrect fastener can cause high resistance in the 200 amp fuse interface, which will generate heat. Customer may notice a Malfunction Indicator Lamp (MIL), a change in drivability, and/or noise at the HV battery pack assembly. Excessive heat in the fuse interface may cause the fuse to fail resulting in a loss of motive power, which can cause a vehicle crash without prior warning.

SERVICE ACTION

FCA US will conduct a voluntary safety recall on all affected equipment to inspect the HV battery fuse for the correct fasteners. If the incorrect fasteners are found, replace the fuse assembly. If charring or discoloration is present on the bus bars, replace the HV battery. The remedy for this condition is not currently available. Dealers will be notified of the launch of this safety recall by way of established communication methods. This recall is estimated to launch in 2nd Quarter of 2023.

We ask that you please take the time to ensure that your personnel are aware of this communication and are prepared to execute a customer friendly process for inquiries regarding involved vehicles.

Customer Services Field Operations
FCA US LLC