

Part 573 Safety Recall Report

23V-006

Manufacturer Name : Triumph Motorcycles America, Ltd.

Submission Date : JAN 27, 2023

NHTSA Recall No. : 23V-006

Manufacturer Recall No. : SRAN 605



Manufacturer Information :

Manufacturer Name : Triumph Motorcycles America, Ltd.

Address : 100 Hartsfield Centre Parkway

Suite 200 Atlanta GA 30354

Company phone : 678-854-2010

Population :

Number of potentially involved : 1,351

Estimated percentage with defect : 1 %

Vehicle Information :

Vehicle 1 : 2022-2023 Triumph Speed Triple RR

Vehicle Type : MOTORCYCLES

Body Style : OTHER

Power Train : GAS

Descriptive Information : The recall population was based upon a review of factory records.

Production Dates : SEP 02, 2021 - OCT 05, 2022

VIN Range 1 : Begin : SMTP02ST1NTAW2194 **End :** SMTP02ST1PTBG4464 Not sequential

Vehicle 2 : 2022-2023 Triumph Speed Triple RS

Vehicle Type : MOTORCYCLES

Body Style : OTHER

Power Train : GAS

Descriptive Information : The recall population was based upon a review of factory records.

Production Dates : FEB 03, 2021 - DEC 22, 2022

VIN Range 1 : Begin : SMTP01ST6NTAF7370 **End :** SMTP01ST8PTBJ3168 Not sequential

Description of Defect :

Description of the Defect : Radiator fan may become inoperative.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : An inoperative fan motor can result in leaking or spraying hot coolant, increasing the risk of injury or crash.

Description of the Cause : Under high ambient temperature and slow moving traffic situations, the maximum operating temperature of the radiator fan can be exceeded, leading to a malfunction of the fan motor. If the rider ignores the instrument warning

light and continues to operate the motorcycle at low speed, coolant may be displaced.

Identification of Any Warning Instrument warning light will illuminate.
that can Occur :

Involved Components :

Component Name 1 : Radiator Fan Assy

Component Description : Fan Assy

Component Part Number : T2100942

Supplier Identification :

Component Manufacturer

Name : Alexon Co Ltd

Address : 51/3 Suwintawong St.

Klongnakomnuangket, Amphur Muang Chachoengsao Foreign States 24000

Country : Thailand

Chronology :

May22: First Warranty claim for replacement fan received.

End of June22: The Triumph Warranty department observes an increase in Warranty claims received and commences an investigation. There are no seized fan Field or Service Reports. There are no deaths or injuries to report.

Aug22: Triumph Quality department requests parts back from the field to verify in-service claims.

Jan23: Triumph Recall Committee agree to launch a voluntary in-service campaign.

Description of Remedy :

Description of Remedy Program : Triumph will install an additional heatshield to affected motorcycles which will deflect the heat away from the radiator fan. Pursuant to 49 CFR §577.11 (e), Triumph requests that it be exempt from providing notification of a reimbursement plan. Any pre-notification product failure would have been addressed under the manufacturer's limited warranty. Accordingly, no person would be eligible for reimbursement pursuant to §573.13."

How Remedy Component Differs from Recalled Component : Defective motorcycles will not have the heat shield fitted. Remedied motorcycles will have the heatshield fitted.

Identify How/When Recall Condition was Corrected in Production : Affected models will be fitted with the additional heatshield once production of these models recommences at the end of January 2023.

Recall Schedule :

Description of Recall Schedule : The planned notification dates are an estimate and may be revised.

Planned Dealer Notification Date : JAN 30, 2023 - JAN 30, 2023

Planned Owner Notification Date : FEB 01, 2023 - FEB 01, 2023

* NR - Not Reported