



Stacy L. Balzer
Operating Director
Service Engineering Operations
Ford Customer Service Division

Ford Motor Company
P. O. Box 1904
Dearborn, Michigan 48121

March 20, 2023

TO: All U.S. Ford and Lincoln Dealers

SUBJECT: **NEW VEHICLE DEMONSTRATION / DELIVERY HOLD**
Compliance Recall 23C01 - Supplement #1
Certain 2023 Model Year F-150 Limited and Platinum
Passenger Instrument Panel Cover Replacement

REF: **NEW VEHICLE DEMONSTRATION / DELIVERY HOLD**
Compliance Recall 23C01
February 16, 2023

New! REASON FOR THIS SUPPLEMENT

- **Service Action:** Parts for the Platinum trim level vehicles are now available. Owner letters are expected to be mailed the week of March 20, 2023.
- **Parts Requirements/Ordering Information:** Part numbers for Platinum trim level vehicles have been added. In addition, the passenger instrument panel covers have been placed on Special Program Part Ordering.

AFFECTED VEHICLES

Vehicle	Model Year	Assembly Plant	Build Dates
F-150 Limited	2023	Dearborn	December 1, 2022, through December 9, 2022
F-150 Platinum	2023	Dearborn	November 29, 2022, through January 11, 2023

Affected vehicles are identified in OASIS and FSA VIN Lists.

Note: Some vehicles may be in the process of being repaired at the plant. Monitor OASIS before opening an RO and/or beginning a repair. Parts purchased for an FSA can be returned for credit, if required. See the EXCESS STOCK RETURN details in Attachment II for more information.

REASON FOR THIS COMPLIANCE RECALL

Some of the affected vehicles may not conform to the requirements specified by Federal Motor Vehicle Safety Standard (FMVSS) No. 208 Occupant Crash Protection. These vehicles may have been built with a passenger-side instrument panel (IP) cover with either an injection molded substrate that was manufactured with contaminated resin or with a skin extruded with contaminated colorant material. Non-conforming instrument panel cover components may alter the intended passenger airbag cushion opening and inflation characteristics. In the event of a crash necessitating deployment of the passenger airbag, the airbag may not deploy as intended, increasing the risk of injury.

New! SERVICE ACTION

Before demonstrating or delivering any new in-stock vehicles involved in this recall, dealers are to replace the passenger instrument panel cover. This service must be performed on all affected vehicles at no charge to the vehicle owner.

Note: Passenger instrument panel cover parts are available for both Limited and Platinum series trim packages. Refer to Attachment IV for Affected Vehicles – VIN List for Limited trim level vehicles.

New! OWNER NOTIFICATION MAILING SCHEDULE

Owner letters are expected to be mailed the week of March 20, 2023. Dealers should repair any affected vehicles that arrive at their dealerships, whether the customer has received a letter or not.

PLEASE NOTE:

Federal law requires dealers to complete this recall service before a new vehicle is delivered to the buyer or lessee. Violation of this requirement by a dealer could result in a civil penalty of up to \$26,315 per vehicle. Correct all vehicles in your new vehicle inventory before delivery.

ATTACHMENTS

Attachment I: Administrative Information
Attachment II: Labor Allowances and *Parts Ordering Information*
Attachment III: Technical Information
Attachment IV: Affected Vehicles – VIN List
Owner Notification Letters
Recall Reimbursement Plan

QUESTIONS & ASSISTANCE

For questions and assistance, contact the Special Service Support Center (SSSC) via the SSSC Web Contact Site. The SSSC Web Contact Site can be accessed through the Professional Technician System (PTS) website using the SSSC link listed at the bottom of the OASIS VIN report screen or listed under the SSSC tab.

Sincerely,



Stacy L. Balzer

NEW VEHICLE DEMONSTRATION / DELIVERY HOLD
Compliance Recall 23C01 - *Supplement #1*
Certain 2023 Model Year F-150 Limited and Platinum
Passenger Instrument Panel Cover Replacement

OASIS ACTIVATION

OASIS was activated on February 16, 2023

FSA VIN LISTS ACTIVATION

FSA VIN Lists were made available through <https://web.fsavinlists.dealerconnection.com> by February 16, 2023. Owner names and addresses will be available by April 12, 2023.

NOTE: Your FSA VIN Lists may contain owner names and addresses obtained from motor vehicle registration records. The use of such motor vehicle registration data for any purpose other than in connection with this recall is a violation of law in several states, provinces, and countries. Accordingly, you must limit the use of this listing to the follow-up necessary to complete this recall.

SOLD VEHICLES

- Ford has not issued instructions to stop selling/delivering or driving used vehicles under this compliance recall. Owners should contact their dealership for an appointment to have their vehicles remedied as soon as practicable.
- Immediately contact any of your affected customers whose vehicles are not on your VIN list but are identified in OASIS. Give the customer a copy of the Owner Notification Letter (when available) and schedule a service date.
- Correct other affected vehicles identified in OASIS which are brought to your dealership.
- Dealers are to prioritize repairs of customer vehicles over repairs of new and used vehicle inventory.

STOCK VEHICLES

- Correct all affected units in your new vehicle inventory before delivery.
- Use OASIS to identify any affected vehicles in your used vehicle inventory.

DEALER-OPERATED RENTAL VEHICLES

The Fixing America's Surface Transportation (FAST) Act law effective June 2016 prohibits a rental company from selling, renting, or leasing vehicles subject to a safety or compliance recall. Please consult your legal counsel for legal advice.

TITLE BRANDED / SALVAGED VEHICLES

Affected title-branded and salvaged vehicles are eligible for this recall.

NEW VEHICLE DEMONSTRATION / DELIVERY HOLD**Compliance Recall 23C01 - *Supplement #1***

Certain 2023 Model Year F-150 Limited and Platinum
Passenger Instrument Panel Cover Replacement

OWNER REFUNDS

- **This safety recall must still be performed, even if the owner has paid for a previous repair. Claiming a refund will not close the recall on the vehicle.**
- Ford Motor Company is offering a refund for owner-paid repairs covered by this recall if the repair was performed before the date indicated in the reimbursement plan, which is posted with this bulletin. Owners are directed to seek reimbursement through authorized dealers or, at their option, directly through Ford Motor Company at P.O. Box 6251, Dearborn, MI 48121-6251.
- Dealers are also pre-approved to refund owner-paid emergency repairs that were performed away from an authorized servicing dealer after the end date specified in the reimbursement plan. Non-covered repairs, or those judged by Ford to be excessive, will not be reimbursed.
- Refunds will only be provided for the cost associated with the passenger airbag cover replacement.

RENTAL VEHICLES

Rental vehicles are not approved for this program.

ADDITIONAL REPAIR (LABOR TIME AND/OR PARTS)

Additional repairs identified as necessary to complete the FSA should be managed as follows:

- For related damage and access time requirements, refer to the Warranty and Policy Manual / Section 6 – Ford & Lincoln Program Policies / General Information & Special Circumstances for FSAs / Related Damage.
- For vehicles within new vehicle bumper-to-bumper warranty coverage, no SSSC approval is required, although related damage must be on a separate repair line with the “Related Damage” radio button checked.
 - Ford vehicles – 3 years or 36,000 miles
- For vehicles outside new vehicle bumper-to-bumper warranty coverage, submit an Approval Request to the SSSC Web Contact Site before completing the repair.

NEW VEHICLE DEMONSTRATION / DELIVERY HOLD**Compliance Recall 23C01 - *Supplement #1***

Certain 2023 Model Year F-150 Limited and Platinum
Passenger Instrument Panel Cover Replacement

CLAIMS PREPARATION AND SUBMISSION

- **Claim Entry:** Enter claims using Dealer Management System (DMS) or One Warranty Solution (OWS) online.
 - When entering claims, select claim type 31: Field Service Action. The FSA number 23C01 is the subcode.
 - For additional claims preparation and submission information, refer to the Recall and Customer Satisfaction Program (CSP) Repairs in the OWS User Guide.
- **Related Damage/Additional labor and/or parts:** Must be claimed as Related Damage on a separate repair line from the FSA with the same claim type and subcode as described in Claim Entry above.

IMPORTANT: Click the Related Damage Indicator radio button.
- **Refunds:** Submit refunds on a separate repair line.
 - Program Code: 23C01 - Misc. Expense: ADMIN
 - Misc. Expense: REFUND - Misc. Expense: 0.2 Hrs.
 - Multiple refunds should be submitted on one repair line and the invoice details for each repair should be detailed in the comments section of the claim.

NEW VEHICLE DEMONSTRATION / DELIVERY HOLD**Compliance Recall 23C01 - *Supplement #1***

Certain 2023 Model Year F-150 Limited and Platinum

Passenger Instrument Panel Cover Replacement

LABOR ALLOWANCES

Description	Labor Operation	Labor Time
Replace the passenger instrument panel cover	MT23C01B	Up to 3.0 Hours

New! PARTS REQUIREMENTS / ORDERING INFORMATION**Special Program Part Ordering:**

To place an order for the passenger instrument panel cover, submit a Special Program order in the DOW system. **SSSC contact is not required to order K-Coded parts on this program.** More information can be found in EFC 10642.

Part Number	Description	Order Quantity	Claim Quantity
ML3Z-15044F58-GB	Passenger Instrument Panel Cover - F-150 Limited	1	1
<i>ML3Z-15044F58-ED</i>	<i>Passenger Instrument Panel Cover Black Onyx w/Ash - F-150 Platinum</i>	1	1
<i>ML3Z-15044F58-EC</i>	<i>Passenger Instrument Panel Cover Black Onyx w/Carmelo - F-150 Platinum</i>	1	1
W715190-S300	Retaining Pin (2 req./pkg. of 4)	1	2

Dealers will be notified via a DOES II communication if circumstances warrant a change in part supply strategy and when open ordering resumes.

DEALER PRICE

For the latest prices, refer to DOES II.

PARTS RETENTION, RETURN, & SCRAPPING

Follow the provisions of the Warranty and Policy Manual, Section 1 - WARRANTY PARTS RETENTION AND RETURN POLICIES. If a replaced part receives a scrap disposition, the part must be scrapped by all applicable local, state, and federal environmental protection and hazardous material regulations. Federal law prohibits selling motor vehicle parts or components that are under safety, compliance, or emissions recall.

EXCESS STOCK RETURN

The excess stock returned for credit must have been purchased from Ford Customer Service Division by Policy Procedure Bulletin 4000.

NEW VEHICLE DEMONSTRATION / DELIVERY HOLD
Compliance Recall 23C01 - *Supplement #1*
Certain 2023 Model Year F-150 Limited and Platinum
Passenger Instrument Panel Cover Replacement

REPLACED FSA PARTS INSPECTION AND SIGN OFF

Effective March 1st, 2021, all parts replaced as part of an FSA repair with a repair order open date of March 1st, 2021, or later must be inspected and signed off on the repair order by a member of your dealer fixed operations management team or an employee the task has been delegated to. If the task is to be delegated to a non-management employee, the employee needs to be someone other than the technician who completed the repair and needs to understand the importance of completing this task consistently and accurately.

- All parts replaced as part of an FSA repair should be returned to the parts department following the Warranty Parts Retention and Return Policies.
- Inspect the replaced parts to verify the FSA repair was completed.
- If the FSA repair is found to be complete, the designated employee signs the repair order line or parts return stamp area (electronic or hand signed) for the FSA repair indicating the parts were inspected and validated to have been replaced.
- After the parts have been inspected, they should be handled based on the guidance in the parts status report in the Online Warranty System (Hold, Return, CORE, Scrap, etc.).
- This process is subject to review during warranty audits for FSA repairs with a repair order open date of March 1st, 2021, or later. Any eligible FSA claims requiring parts replacement found not to have been inspected and signed off during a warranty audit will be subject to chargeback and consideration for enrollment into the Dealer Incomplete Recall Repair Process.

Note: Other approvals (electronic or handwritten) for add-on repair lines, dealer-owned vehicle repairs, and repeat repairs do not qualify as FSA parts inspection approvals. The post-repair FSA parts inspection process (electronic or handwritten) is independent of other warranty approval requirements. The approval by the designated employee implies that the FSA parts were found to be replaced and must be able to be identified on the Repair Order. If multiple FSAs require approval on a single Repair Order, each applicable occurrence will require individual post-repair approval by the designated employee.

CERTAIN 2023 MODEL YEAR F-150 VEHICLES — PASSENGER SIDE INSTRUMENT PANEL COVER REPLACEMENT

SERVICE PROCEDURE

NOTE: For this procedure only it is not necessary to remove the instrument panel.

NOTE: Retaining clip/bolt quantities may vary from what is shown throughout this procedure.

1. Depower the Supplemental Restraint System (SRS). Please follow the Workshop Manual (WSM) procedures in Section 501-20B.
2. Remove the A-pillar trim panels. Please follow the WSM procedures in Section 501-05.
3. Release the clips and remove the Right Hand (RH) instrument panel trim panel. See Figure 1.

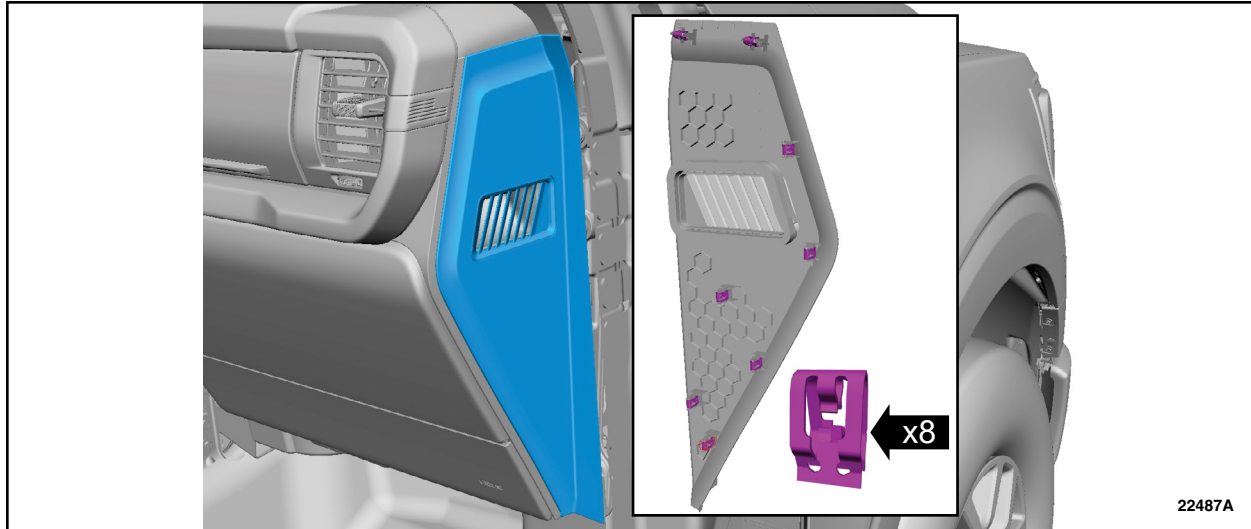


FIGURE 1



4. Release the clips and remove the defrost grille trim panel. See Figure 2.

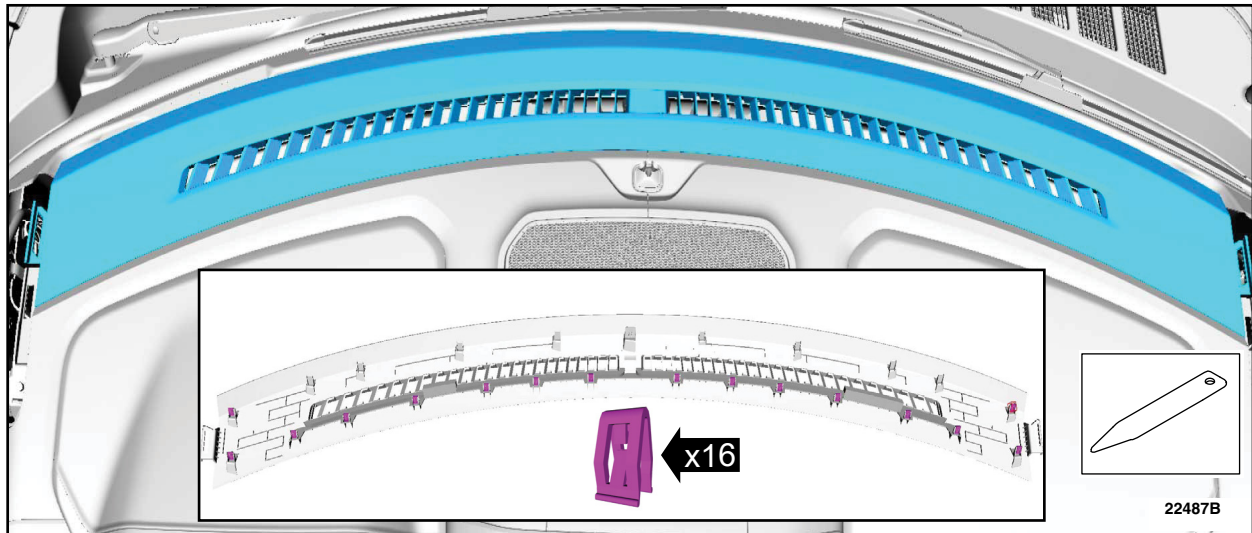


FIGURE 2

5. Release the clips and remove the trim panel. See Figure 3.

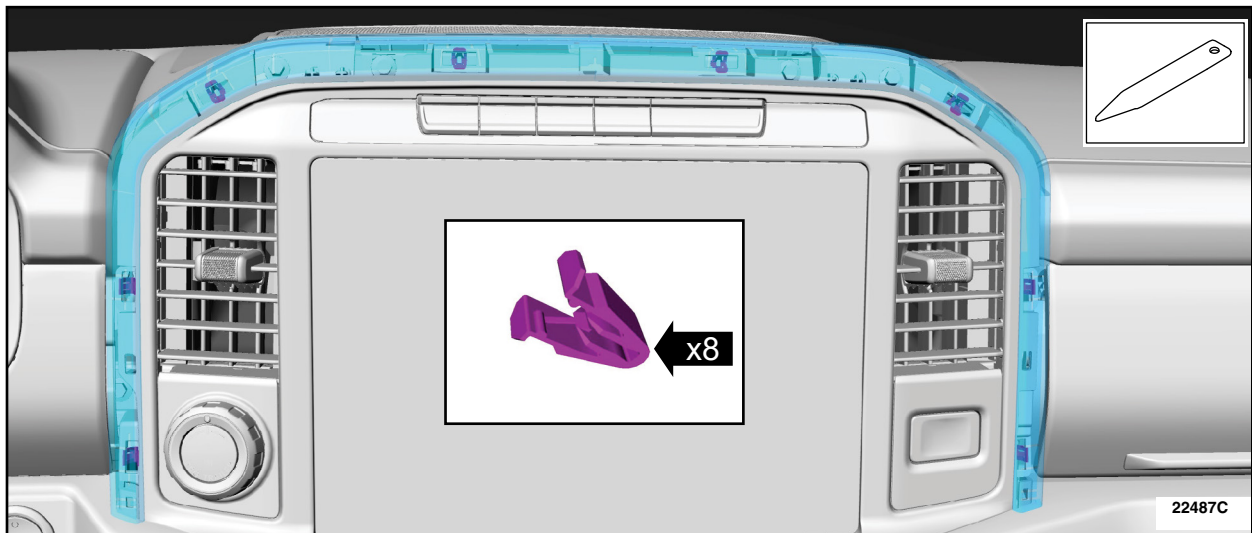


FIGURE 3



6. Release the clips, disconnect the electrical connector and remove the center finish trim. See Figure 4.

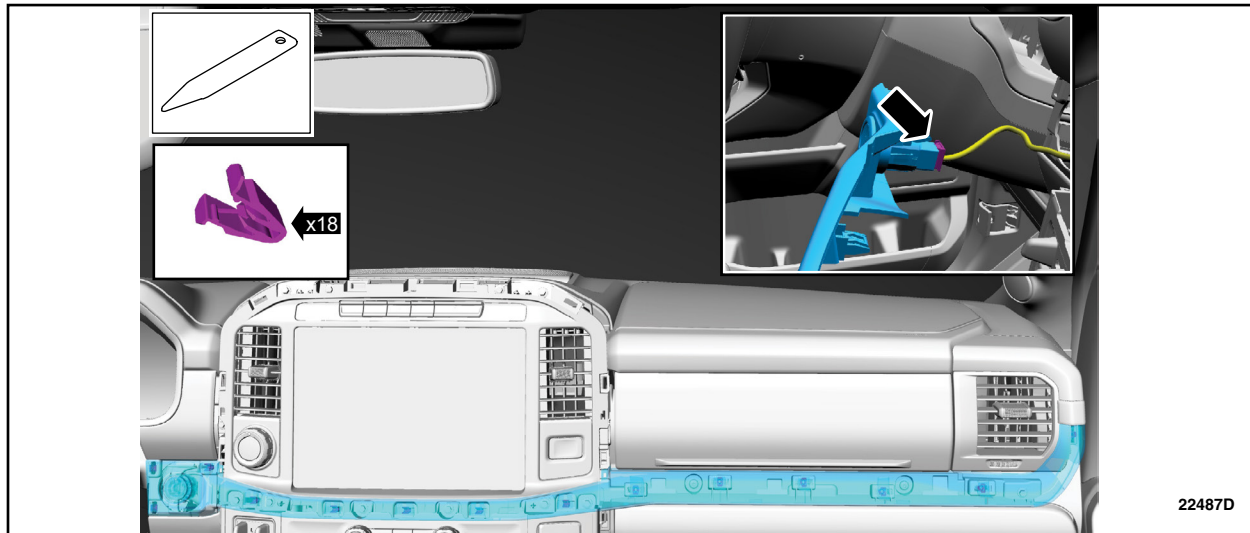


FIGURE 4

7. Release the clips and remove the floor console lower RH trim panel. See Figure 5.

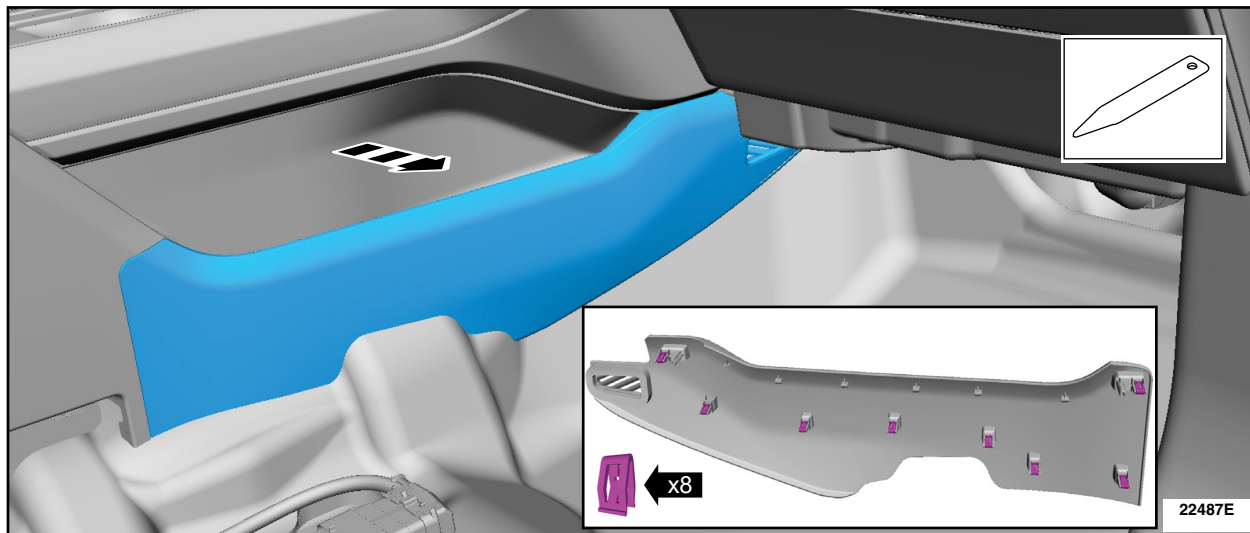


FIGURE 5



8. Release the clips and remove the floor console upper RH trim panel. See Figure 6.

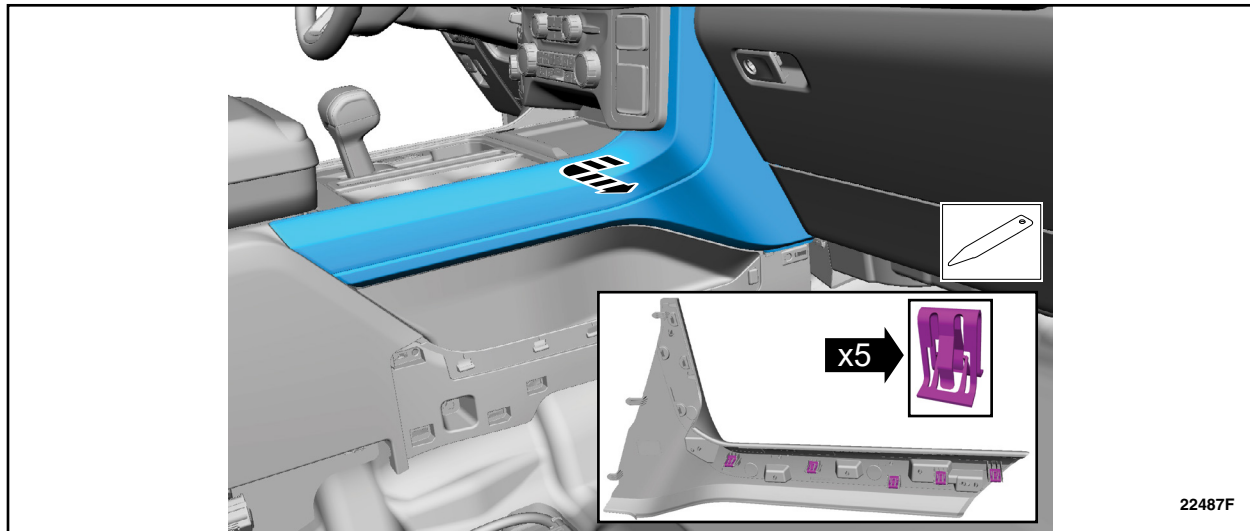


FIGURE 6

9. Remove the bolt, release the clips and remove the floor console lower Left Hand (LH) trim panel. See Figure 7.

• Torque 22 lb.in (2.5 Nm).

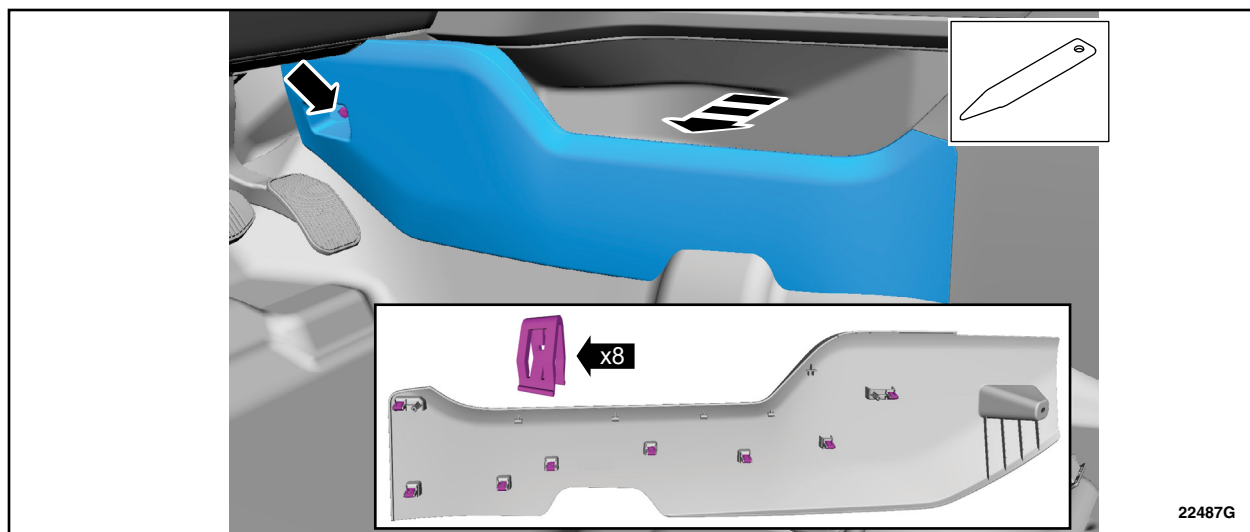


FIGURE 7



10. Release the clips and remove the floor console upper LH trim panel. See Figure 8.



FIGURE 8

11. Remove the bolts, disconnect the electrical connectors and remove the Front Controls Interface Module (FCIM). See Figure 9.

- Torque 22 lb.in (2.5 Nm).

NOTE: Instrument panel removed for clarity.

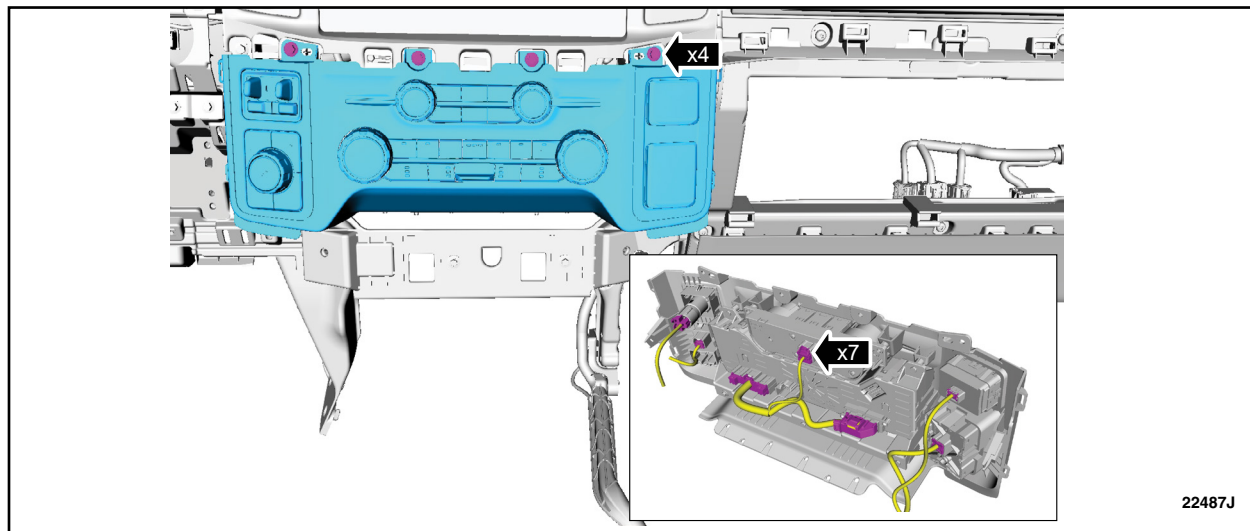


FIGURE 9



12. Release the clips and remove the speaker grille. See Figure 10

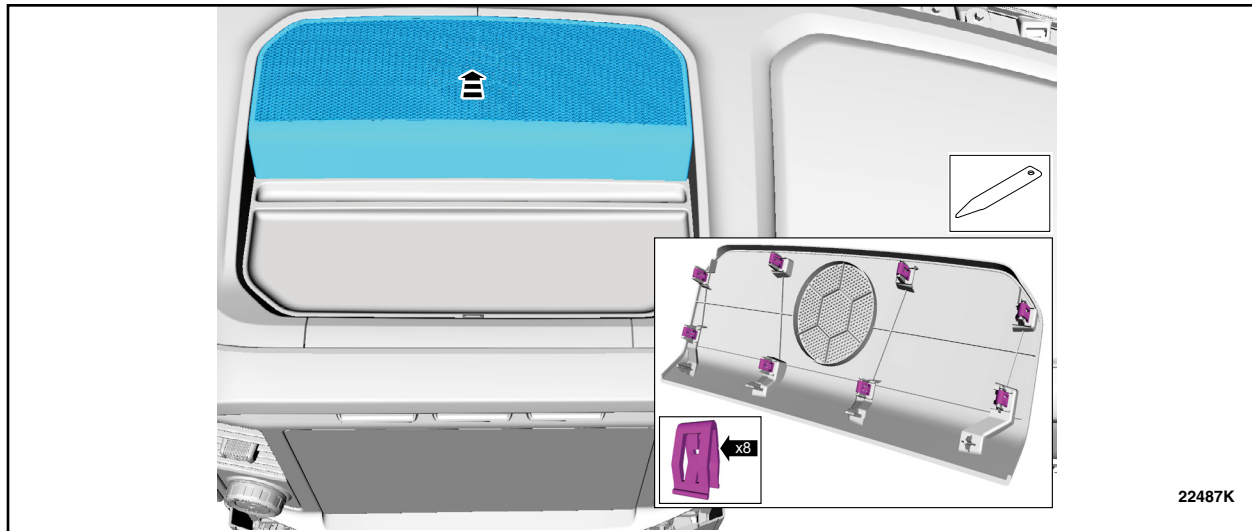


FIGURE 10

NOTE: If equipped remove the rubber pad. See Figure 11.

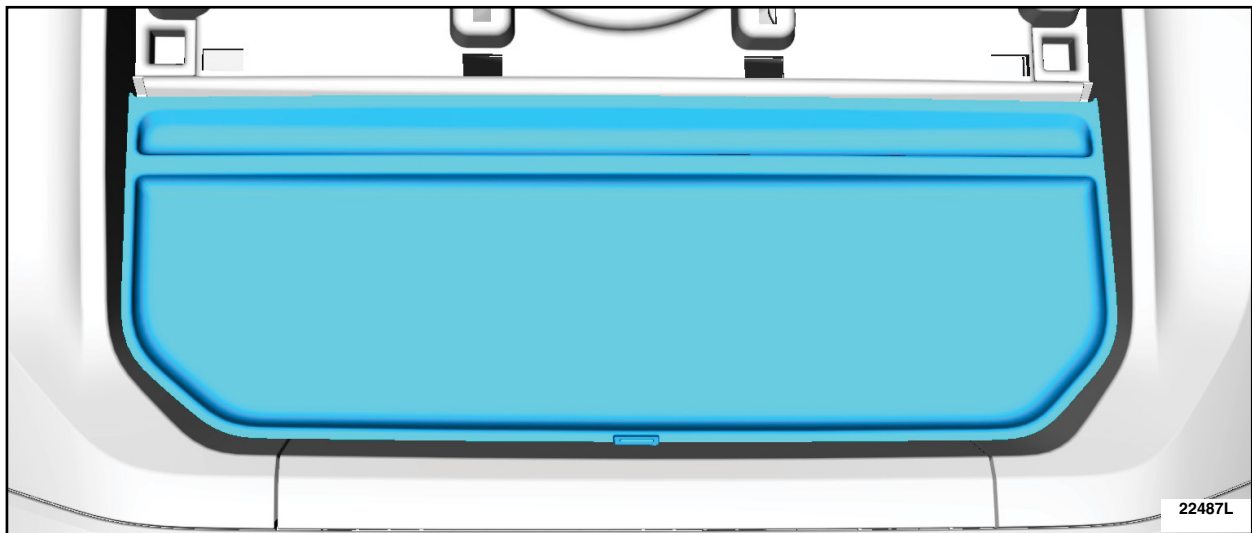


FIGURE 11



13. Remove the bolts, disconnect the electrical connector and remove the upper instrument panel storage tray. See Figure 12.

- Torque 22 lb.in (2.5 Nm).

NOTE: Instrument panel removed for clarity.

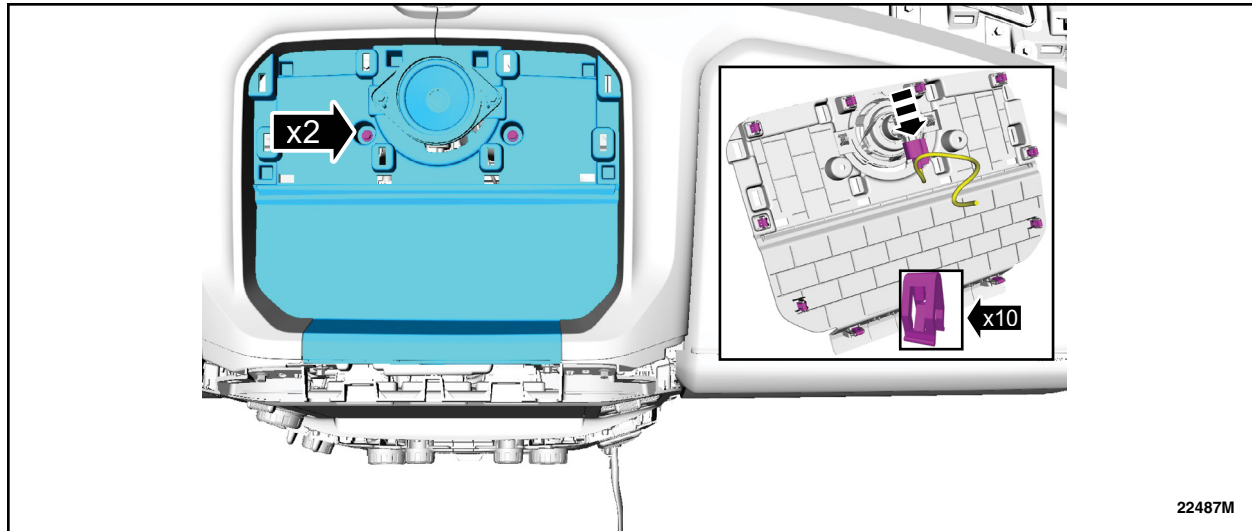


FIGURE 12

14. Remove the bolts. See Figure 13.

- Torque 42.48 lb.in (4.8 Nm).

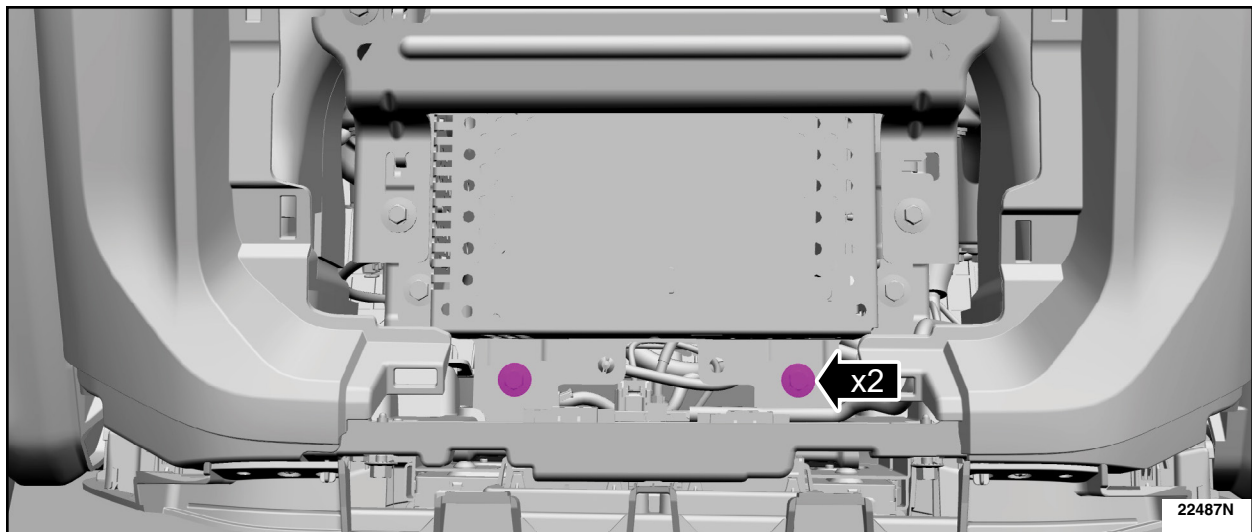


FIGURE 13



15. Release the retainers, remove and discard the push pin and remove the LH register bezel. See Figure 14.

NOTE: The push pin must be replaced each time the bezel is removed.

NOTE: Instrument panel removed for clarity.

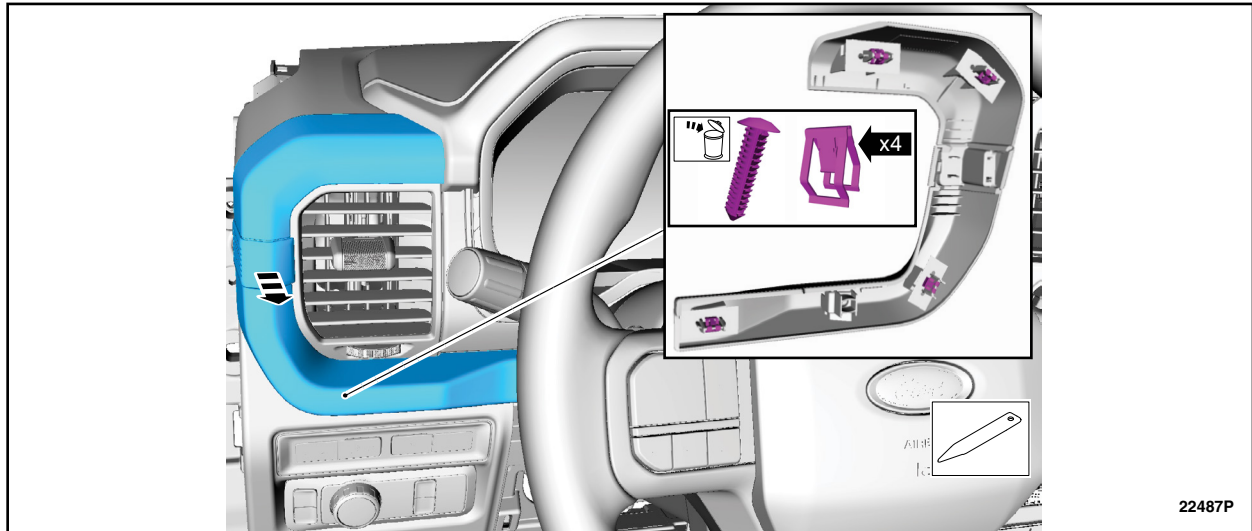


FIGURE 14

16. Remove the bolts, separate the gap hider from the upper steering column shroud, release the 7 clips and remove the IPC bezel. See Figure 15.

- Torque 36 lb.in (4.1 Nm).

NOTE: Instrument panel removed for clarity.

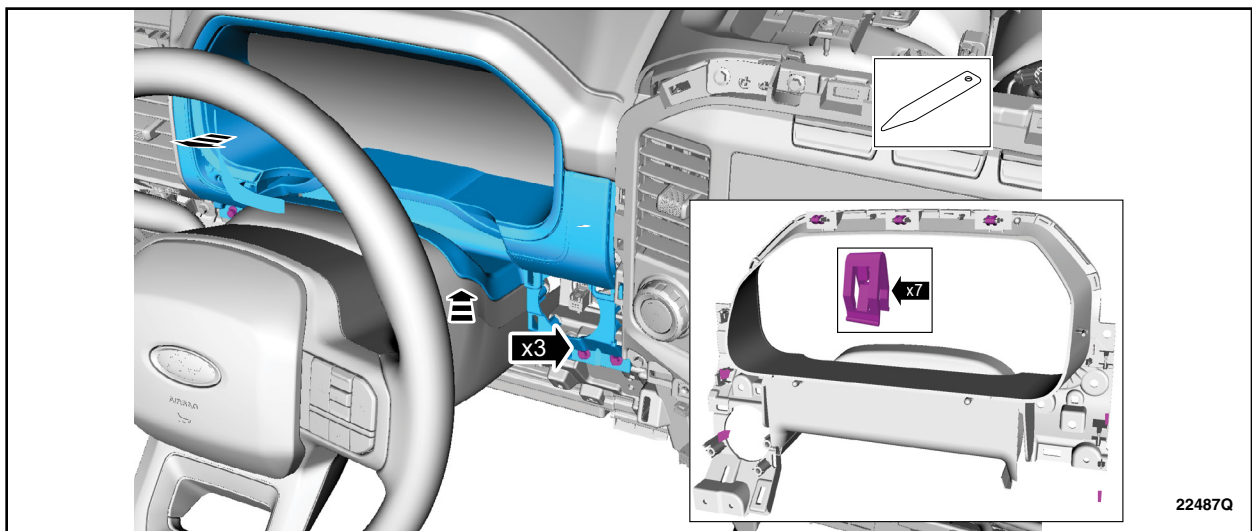


FIGURE 15



17. Remove the bolts, disconnect the electrical connectors and remove the display unit. See Figure 16.

- Torque 22 lb.in (2.5 Nm).

NOTE: Instrument panel removed for clarity.

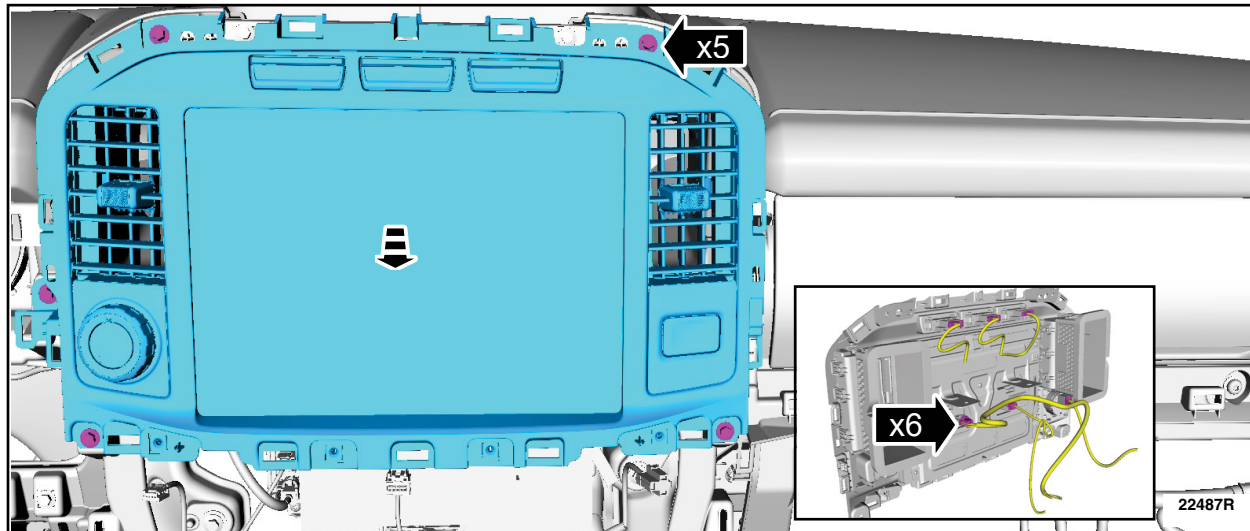


FIGURE 16

18. Release the retainers and remove and discard the push pin. Remove the RH register bezel. See Figure 17.

NOTE: The push pin must be replaced each time the bezel is removed.

NOTE: Instrument panel removed for clarity.

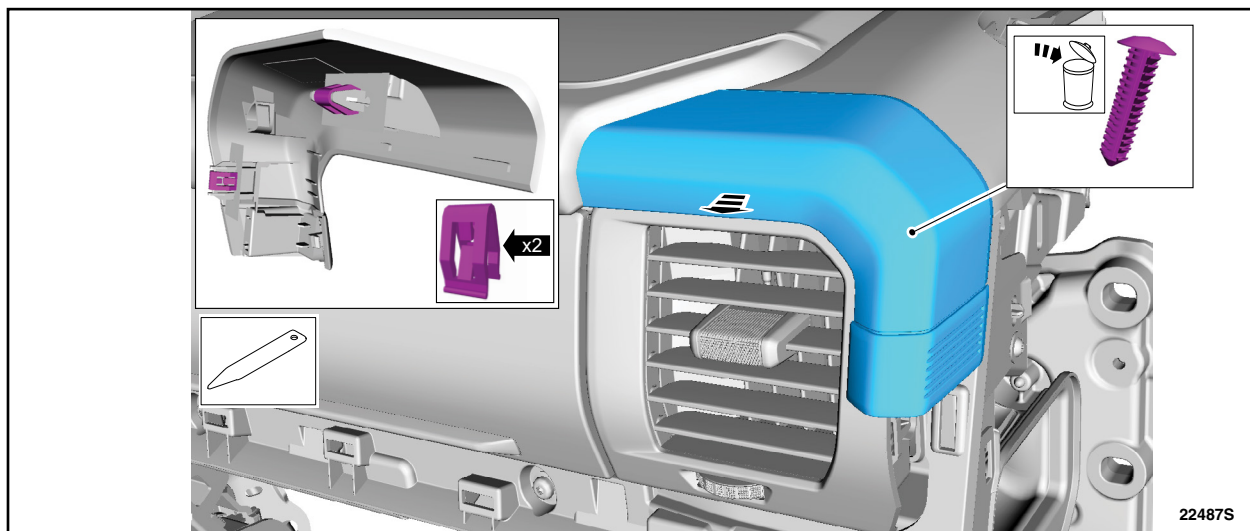


FIGURE 17



19. Remove the bolt and the RH register. See Figure 18.

- Torque 22 lb.in (2.5 Nm).

NOTE: Instrument panel removed for clarity.

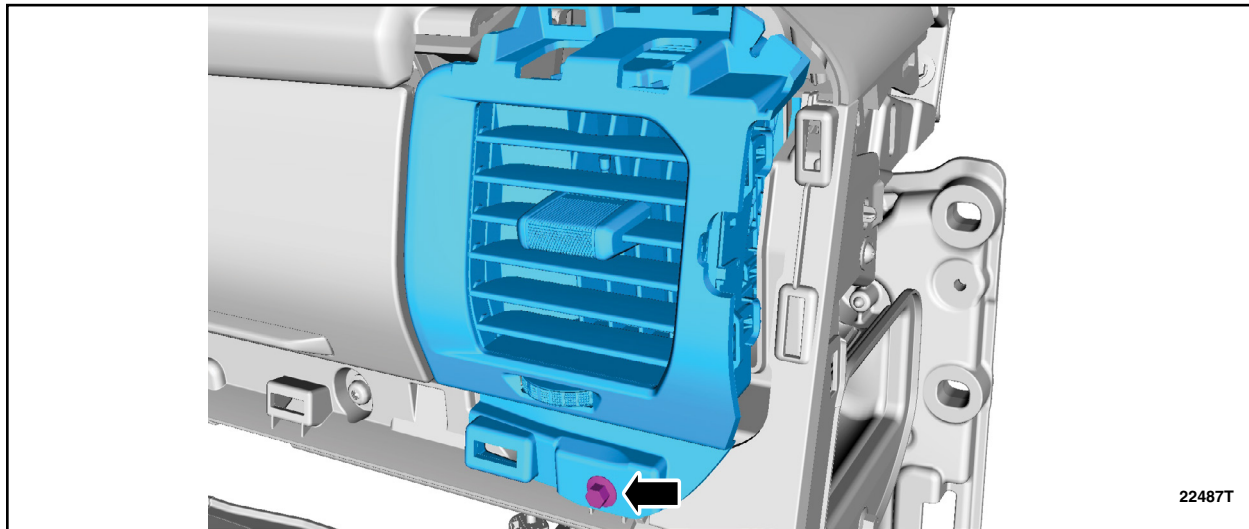


FIGURE 18

20. Remove the bolts and remove the upper storage compartment. See Figure 19.

- Torque 22 lb.in (2.5 Nm).

NOTE: Instrument panel removed for clarity.

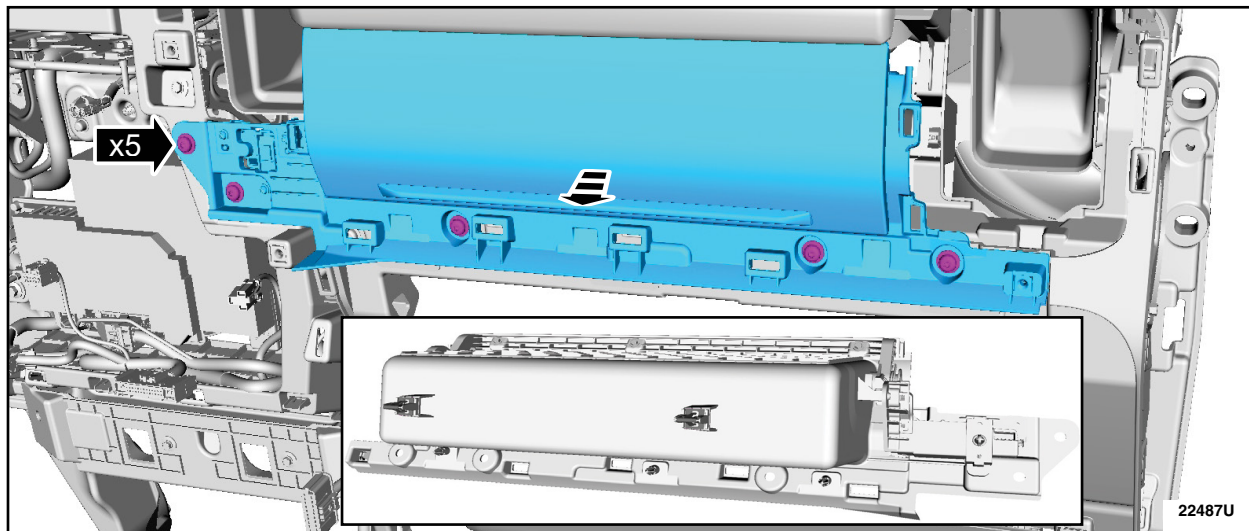


FIGURE 19



21. Remove the screws through the upper stowage bin opening. See Figure 20.

- Torque 11.5 lb.in (1.3 Nm).

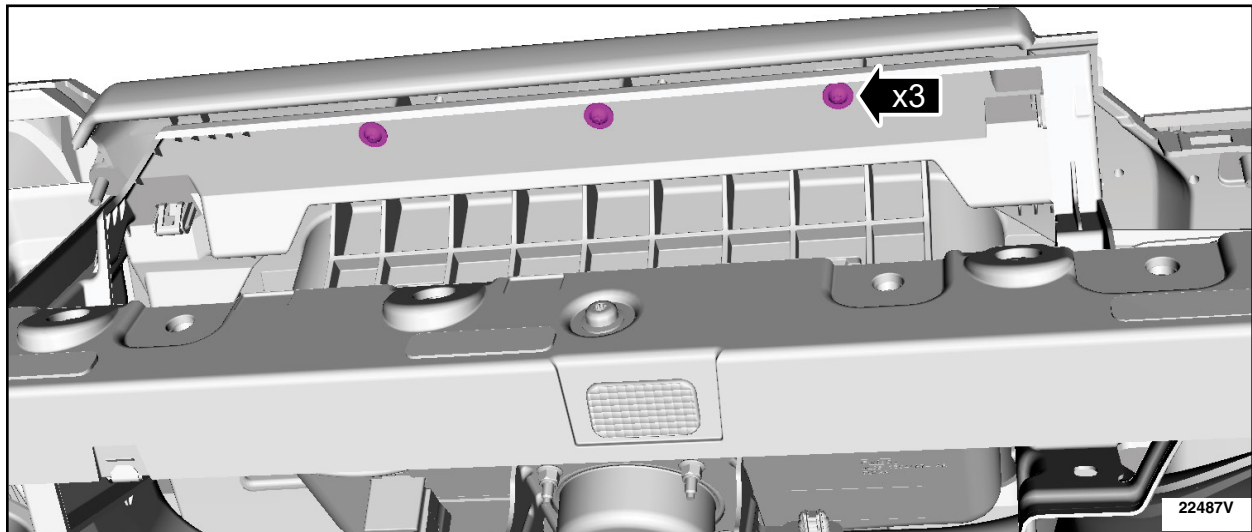


FIGURE 20

22. Remove the bolts. See Figure 21.

- Torque 93 lb.in (10.5 Nm).

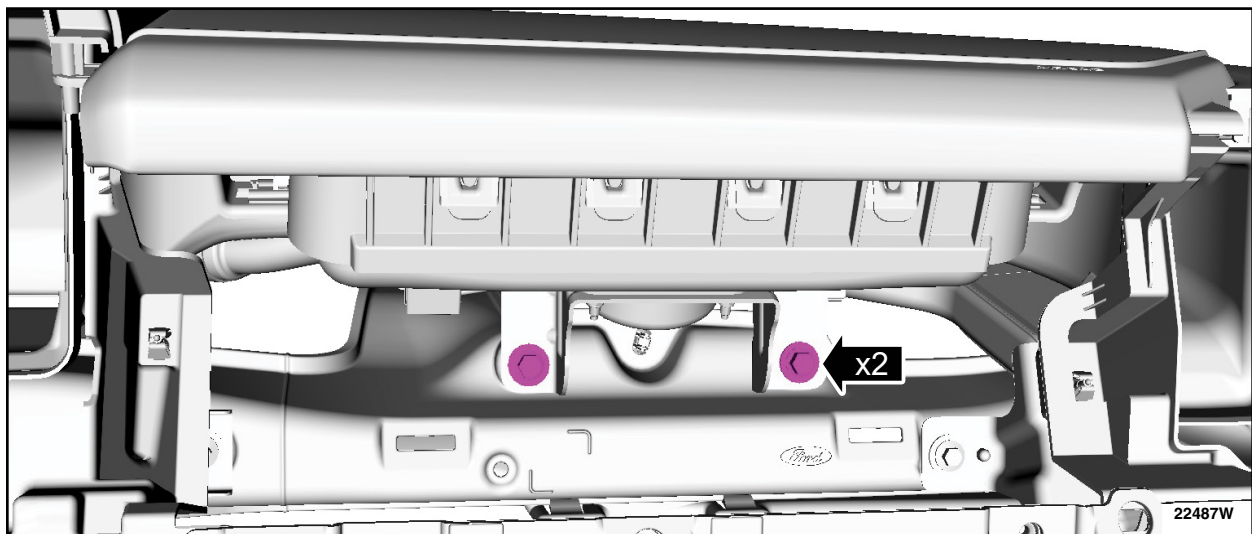


FIGURE 21



23. Disconnect the passenger airbag electrical connector. See Figure 22.

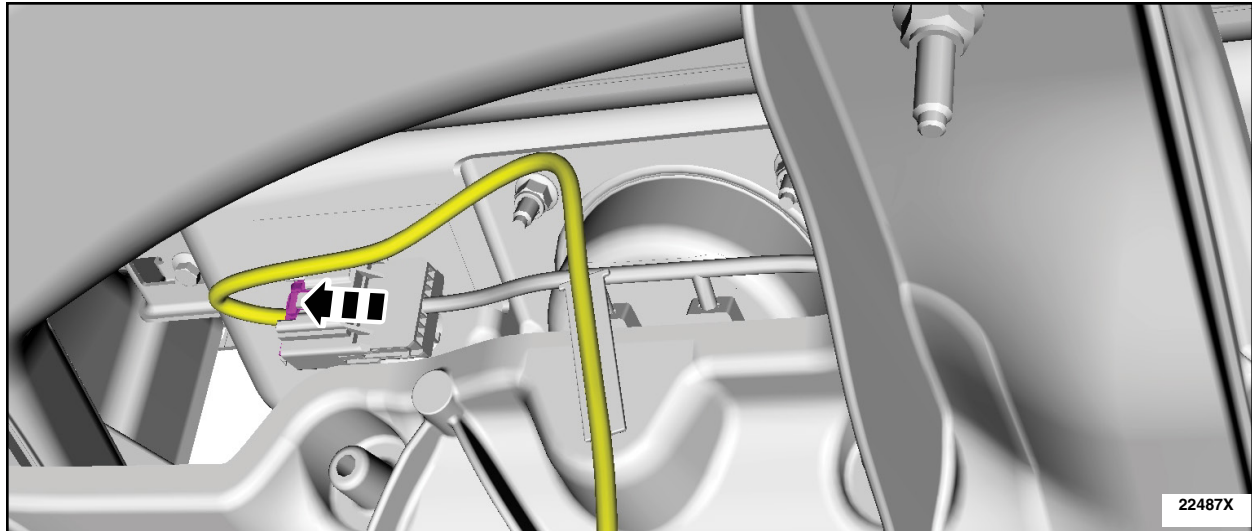


FIGURE 22

24. Remove the RH instrument panel upper section bolts. See Figure 23.

- Torque 22 lb.in (2.5 Nm).

NOTE: Instrument panel removed for clarity.



FIGURE 23



25. Remove the RH instrument panel upper section by lifting upwards to release the clips. See Figure 24.

NOTE: Instrument panel removed for clarity.

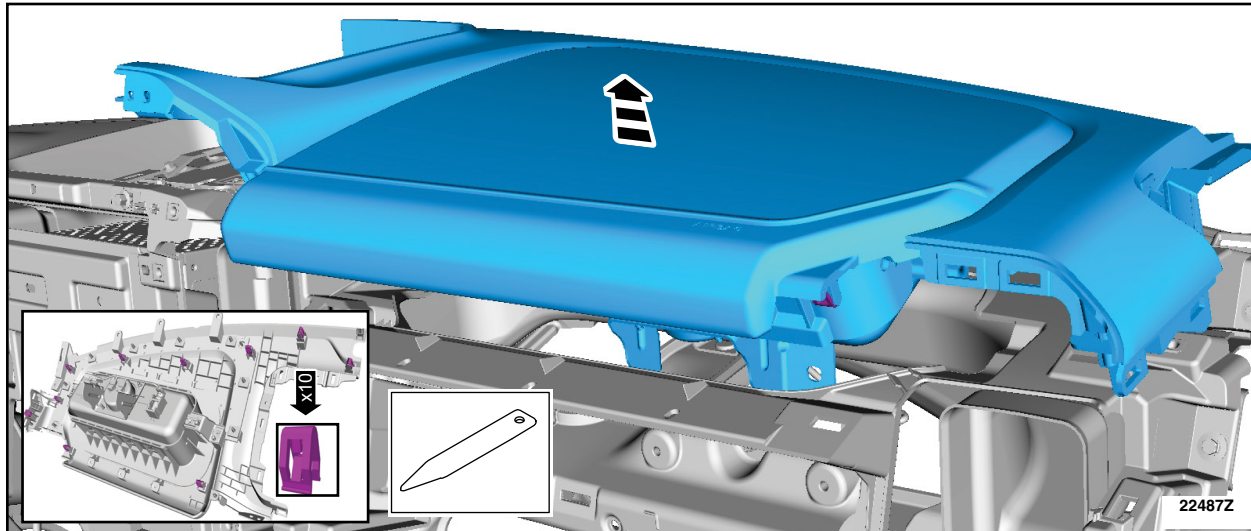


FIGURE 24

26. Transfer the passenger airbag to the *new* passenger side instrument panel upper section. Please follow the WSM procedures in Section 501-20B.

27. Install the *new* passenger side instrument panel upper section, by reversing the removal procedure, starting at Step 25.

IMPORTANT NOTE: Federal law prohibits selling motor vehicle parts or components that are under safety, compliance, or emissions recall. Unless a part is requested to be returned to Ford, all parts replaced under this FSA must be scrapped in accordance with all applicable local, state and federal environmental protection and hazardous material regulations. Refer to the Parts Retention, Return, & Scrapping section of the FSA dealer bulletin for further information.



NEW VEHICLE DEMONSTRATION / DELIVERY HOLD
Compliance Recall 23C01
Certain 2023 Model Year F-150 Limited and Platinum
Passenger Instrument Panel Cover Replacement

AFFECTED VEHICLES

Parts are available for the VINs in the table below. These vehicles will require repairs before delivery to customers.

VIN #

1FTFW1EDXPFA36070
1FTFW1ED3PFA37027
1FTFW1ED7PFA36611
1FTFW1ED6PFA35398
1FTFW1ED1PFA32926
1FTFW1ED8PFA32082
1FTFW1ED6PFA31822
1FTFW1ED7PFA43140
1FTFW1ED3PFA41689
1FTFW1ED1PFA42923
1FTFW1ED9PFA41566

Ford Motor Company
Recall Reimbursement Plan for 23C01

Ford and Lincoln dealers are in the best position to quickly and efficiently process reimbursement requests. However, federal legislation requires all motor vehicle manufacturers to establish processes through which customers may seek recall reimbursement directly from the manufacturer or the dealers.

Regarding the specific reimbursement plan for Recall # 23C01, owners who have paid for service to remedy the defect or noncompliance must have had that service performed before April 21, 2023. After this date, if repairs related to this recall are performed by a non-Ford repair facility in an emergency, customers must submit any refund requests through their dealership. As required by this federal regulation, Ford Motor Company submitted the details of its latest General Recall Reimbursement Plan in a letter to the National Highway Traffic Safety Administration (NHTSA) in May 2021. The following is the text of that letter and the Plan:

General Recall Reimbursement Plan
(As submitted to the NHTSA)

Under the requirements outlined in 49 CFR Part 573 and Part 577 of the Code of Federal Regulations, Ford Motor Company (Ford) is submitting the required information about our general reimbursement plan for the cost of remedies paid for by vehicle owners before they are notified of a related safety recall.

Set forth below is Ford's general plan to reimburse owners and purchasers for costs incurred for remedies in advance of notification of potential safety-related defects or noncompliance under Part 573.6 (c)(8)(i). This plan has not changed since our February 20, 2019 submission.

Reimbursement Notification

Ford's notice to a vehicle owner by 49 CFR Part 577 will indicate that Ford is offering a refund if the owner paid to have service to remedy the defect or noncompliance before a specified ending date. By Part 573.13 (c)(2), this ending date will be defined as a minimum of ten calendar days after the date on which Ford mailed the last of its Part 577 notifications to owners and will be indicated in the specific reimbursement plan available to owners for an individual recall. This notice will direct owners to seek eligible reimbursement through authorized dealers or, at their option, directly through Ford at the following address:

Ford Motor Company
P.O. Box 6251
Dearborn, MI 48121-6251

Ford notes that this rule allows for the identification of a beginning date for reimbursement eligibility. Under the rule, an owner who paid to remedy the defect or noncompliance before the identified beginning date would not be eligible for reimbursement. Ford generally has not established such a beginning date for reimbursement eligibility and does not presently anticipate changing this general policy. However, in any case, where Ford determines a beginning date is appropriate, Ford will indicate that date in the owner's notice. As permitted by 577.11(e), Ford may not include a reimbursement notification when all vehicles are well within the warranty period, subject to approval by the agency.

Costs to be Reimbursed

For vehicles, reimbursement will not be less than the lesser of:

- The amount paid by the owner for the remedy that specifically addressed and was reasonably necessary to correct the defect or noncompliance that is the subject of the recall, or
- The cost of parts for the remedy (to be no more than the manufacturer's list retail price for authorized part(s), plus associated labor at local labor rates, miscellaneous fees (such as disposal of waste), and taxes.

For replacement equipment, reimbursement will be the amount paid by the owner for the replacement item (limited by the amount of the retail list price of the defective or noncompliant item that was replaced, plus taxes, where the brand or model purchased by the owner was different from the brand or model that was the subject of the recall). If the item of motor vehicle equipment was repaired, the reimbursement provisions identified above for vehicles will apply.

Ford notes that costs incurred by the owner within the period during which Ford's original or extended warranty would have provided for a free repair of the problem will not be eligible for reimbursement, as provided by Part 573.13 (d)(1).

Entities Authorized to Provide Reimbursement

Ford will continue to use authorized dealers to reimburse owners under the specific reimbursement plans for a particular recall and will encourage owners to pursue requests for reimbursement directly through dealers to expedite reimbursement. Ford will also provide a mailing address to which customers can, at their option, send requests for reimbursement directly to Ford, as previously noted. Requests for reimbursement sent directly to Ford may take up to 60 days to process. Whether the owner chooses to pursue reimbursement requests through a dealer or directly through Ford, the owner will be directed to submit the required documentation, upon which reimbursement eligibility will be determined.

Required Documentation

The reimbursement determination will depend upon the information provided by the customer. Consistent with Part 573.13 (d)(4) the following information must be submitted:

- Claimant's name and address
- Vehicle make, model, and model year
- Vehicle identification number (VIN) and, for replacement equipment, a description of such equipment or, for tires, the model, size, and TIN (DOT code)
- Identification of the recall number (either the Ford recall number or the NHTSA recall number)
- Identification of the owner of the recalled vehicle at the time that the pre-notification remedy was obtained
- An original receipt for the pre-notification remedy that includes a breakdown of the amount for parts, labor, other costs, and taxes, including costs for the replacement item. Where the receipt covers work other than to address the recall or noncompliance, Ford may require the claimant to separately identify costs that are eligible for reimbursement.
- If the remedy was obtained during the warranty period, documentation indicating that the warranty was not honored or the warranty repair did not correct the problem related to the recall.

Failure to submit all of the above information may result in the denial of the reimbursement request.

Additional Information

The Part 577 required owner notice will provide a toll-free telephone number through which specific information about the reimbursement plan can be requested from Ford. This general reimbursement plan will be incorporated into notifications under Part 573.6 by reference. Information specific to an individual recall also may be incorporated into the Part 573.6 notification.