OMB Control No.: 2127-0004

Part 573 Safety Recall Report

23V-093

Manufacturer Name: Nissan North America, Inc.

NHTSA Recall No.: 23V-093
Manufacturer Recall No.: R22C5



Manufacturer Information:

Manufacturer Name: Nissan North America, Inc.

Address: P. O. BOX 685001

Franklin TN 37068-5009

Company phone: 800-647-7261

Population:

Number of potentially involved: 712,458 Estimated percentage with defect: 1 %

Vehicle Information:

Vehicle 1: 2017-2022 Nissan Rogue Sport

Vehicle Type: LIGHT VEHICLES Body Style: HATCHBACK

Power Train: GAS

Descriptive Information: Based on production records, this issue is unique to "S" Grade trim level Nissan Rogue

Sport and Nissan Rogue vehicles equipped with a jackknife key manufactured at the Kyushu, Smyrna, and Renault plants listed above. Nissan Rogue Sport and Rogue vehicles manufactured after this date are unaffected because Intelligent Key (i-key) was adopted into production and the jackknife style key was no longer manufactured.

No other Nissan or INFINITI vehicles are affected.

Production Dates: NOV 28, 2016 - JUN 20, 2022

Vehicle 2: 2014-2020 Nissan Rogue

Vehicle Type: LIGHT VEHICLES Body Style: HATCHBACK

Power Train: GAS

Descriptive Information: Based on production records, this issue is unique to "S" Grade trim level Nissan Rogue

Sport and Nissan Rogue vehicles equipped with a jackknife key manufactured at the Kyushu, Smyrna, and Renault plants listed above. Nissan Rogue Sport and Rogue vehicles manufactured after this date are unaffected because Intelligent Key (i-key) was adopted into production and the jackknife style key was no longer manufactured.

No other Nissan or INFINITI vehicles are affected.

Production Dates: AUG 07, 2013 - AUG 14, 2020

VIN Range 1 : Begin : NR End : NR Not sequential

Description of Defect:

Description of the Defect: The jackknife key may not hold the key blade in the extended "open" position.

Over time the internal pivot of the jackknife key may weaken, and the key fob

could unlock and rotate downwards.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: If the vehicle is driven with the key in the collapsed position, contact with the

key fob by the driver could inadvertently turn the vehicle off while driving,

increasing the risk of a crash.

Description of the Cause: NR

Identification of Any Warning There is no warning to the customer.

that can Occur:

Involved Components:

Component Name 1: Key Set

Component Description: Jackknife Key Set

Component Part Number: 80561 – 4BA1B

Supplier Identification:

Component Manufacturer

Name: NR

Address: NR

NR

Country: NR

Chronology:

Chronology will be supplemented.

Description of Remedy:

Description of Remedy Program: Nissan is preparing the remedy for this issue. In the interim, registered owners will be notified. In that notification, owners will be instructed to avoid attaching accessories to the key fob and to use the key in the nonfolding orientation until the remedy is available. In addition, dealers and rental fleets will be instructed on an interim remedy to insert a fastener into the key slot that will prevent the key from folding. When remedy parts are available, dealers will insert a spacer into the key slot of the customer's key fob that will not allow the key to collapse.

> Nissan will include a statement in the Part 577 owner notification concerning reimbursement for the cost of obtaining a pre-notification remedy since the subject vehicles are no longer under warranty.

How Remedy Component Differs NR from Recalled Component:

Identify How/When Recall Condition NR was Corrected in Production:

Recall Schedule:

Description of Recall Schedule: Dealers will be notified beginning February 17, 2023. Owners of all

potentially affected vehicles will be notified beginning March 2023.

Planned Dealer Notification Date: FEB 17, 2023 - NR Planned Owner Notification Date: MAR 17, 2023 - NR

* NR - Not Reported