OMB Control No.: 2127-0004

Part 573 Safety Recall Report

23V-400

Manufacturer Name: Autocar, LLC
Submission Date: JUN 02, 2023
NHTSA Recall No.: 23V-400

Manufacturer Recall No.: ACX-2307 DC-2303



Manufacturer Information:

Manufacturer Name: Autocar, LLC

Address: 551 S WASHINGTON STREET

HAGERSTOWN IN 47346

Company phone: 7654895499

Population:

Number of potentially involved: 10,894 Estimated percentage with defect: 100 %

Vehicle Information:

Vehicle 1: 2016-2023 Autocar ACX (Xpeditor)
Vehicle Type: BUSES, MEDIUM & HEAVY VEHICLES

Body Style : OTHER Power Train : NR

Descriptive Information: All ACX (Xpeditor) and DC (Legend) vehicles manufactured with the suspect pressure

switch are included.

Production Dates: DEC 03, 2015 - MAR 03, 2023

VIN Range 1: Begin: 5VCA3RLE7GH221097 End: 5VCACLDF7PC241058 ✓ Not sequential

Vehicle 2: 2020-2023 Autocar DC (Legend)
Vehicle Type: BUSES, MEDIUM & HEAVY VEHICLES

Body Style : OTHER Power Train : NR

Descriptive Information: The parking brake telltale may illuminate

Production Dates: AUG 20, 2019 - MAY 02, 2023

VIN Range 1: Begin: 5VCCCLEG6LC231616 End: 5VCCCLEH3PC245682 ✓ Not sequential

Description of Noncompliance:

Description of the During an air loss event below 70 PSI. The park brake telltale may illuminate in

Noncompliance: error.

FMVSS 1: 101 - Control and displays

FMVSS 2: NR

Description of the Safety Risk: Non-compliance 49 CFR 571.101 A telltale must not emit light except when

identifying the malfunction or vehicle condition it is designed to indicate, or

during a bulb check. If the telltale illuminates in error the result could

increase the risk of a crash.

Description of the Cause: An Autocar internal process error.

Identification of Any Warning During an air loss event below 70 PSI. The park brake telltale may illuminate in

that can Occur: error.

Involved Components:

Component Name 1: Autocar Pressure Switch
Component Description: Autocar Pressure Switch

Component Part Number: A8731085-001

Supplier Identification:

Component Manufacturer

Name: Autocar LLC

Address: 551 S Washington St

Hagerstown Indiana 47346

Country: United States

Chronology:

August 26, 2022, during an internal validation test, Autocar personnel discovered during an air loss event, the telltale could illuminate in error and an internal investigation was began. September 7, 2022, through October 18, 2022, initial investigation continued. October 18, 2022, through March 2023, the investigation was escalated internally, and verification determined. May 25, 2023, all relevant information was presented to Autocar management team and out of an abundance of caution, Autocar decides to perform a voluntary safety recall. We have no known complaints, claims or reports.

Description of Remedy:

Description of Remedy Program: Autocar will voluntarily initiate an owner notification and recall of all

affected vehicles. Autocar will distribute to owners of affected vehicles an Owner Notification Letter, which will describe the defect and provide instructions for scheduling the inspection/repair of the vehicle at no cost to the vehicle's owner. The owner letter will instruct vehicle owners who have paid to have this condition remedied prior to this campaign to seek reimbursement pursuant to Autocar's General Reimbursement Plan, on file with the agency pursuant to 49 C.F.R. 573.6(c) (8) (i) and 49 C.F.R 573.13

from Recalled Component:

How Remedy Component Differs The repair process is currently under development.

was Corrected in Production:

Identify How/When Recall Condition The repair is process is currently under development.

Recall Schedule:

Description of Recall Schedule: Dealer and owner notifications will begin July 31, 2023, and end August

1.2023.

Planned Dealer Notification Date: JUL 31, 2023 - AUG 01, 2023 Planned Owner Notification Date: JUL 31, 2023 - AUG 01, 2023

* NR - Not Reported