#### OMB Control No.: 2127-0004

# Part 573 Safety Recall Report

## 23V-454

Manufacturer Name: Airstream, Inc.
Submission Date: JUN 28, 2023
NHTSA Recall No.: 23V-454
Manufacturer Recall No.: NR



#### **Manufacturer Information:**

Manufacturer Name: Airstream, Inc.

Address: 419 West Pike Street

PO Box 629 Jackson Center OH

45334-0629

Company phone: 937-596-6111

## **Population:**

Number of potentially involved : 105 Estimated percentage with defect : 100 %

#### **Vehicle Information:**

Vehicle 1: 2023-2024 Airstream Interstate 24 & Interstate 19

Vehicle Type: BUSES, MEDIUM & HEAVY VEHICLES

Body Style : VAN
Power Train : DIESEL

Descriptive Information: To determine the population, Airstream is including model year 2023 & 2024

Interstate 24 & Interstate 19 units (excluding lithium and Interstate 24X units) which began production on 2/10/2023, and ended the affected population on 6/20/2023.

This is the date the correction was made in production.

Production Dates: FEB 09, 2023 - JUN 20, 2023

#### **Description of Defect:**

Description of the Defect: On certain model year 2023 & 2024 Interstate 24 & Interstate 19 motor homes

an improper 200-Amp fuse was installed on the main cable feed that supplies power from the battery to the fuse panel via a buss bar, instead of the correct

50-Amp fuse.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: In the event of of a short circuit, the main cable feed could overheat before

the fuse would break the circuit which would increase the risk of a fire, or

property damage.

Description of the Cause: Ther person who normally assembles the breaker/fuse assembly was out, and

the assemblies were not being assembled according to the print.

Identification of Any Warning Burning smell

that can Occur:

## **Involved Components:**

Component Name 1: Fuse

Component Description: 200-amp Fuse Component Part Number: 512600-200

#### **Supplier Identification:**

## **Component Manufacturer**

Name: NR Address: NR

NR

Country: NR

## **Chronology:**

6/20/2023 - Airstream discovered the fuse issue during an audit & began the investigation. 6/28/23 - The Airstream's Safety Committee met and decided to submit a 573 to NHTSA.

## **Description of Remedy:**

Description of Remedy Program: Dealers will be instructed to complete an inspection. If a 50-amp fuse is

present on the fuse block, no further action is needed. If a 200-amp fuse is present the technician will need to replace the 200-amp fuse with the 50-amp fuse. Customers will be allowed reimbursement following the general

reimbursement plan on file with NHTSA

How Remedy Component Differs The incorrect 200-amp fuse is blue, and the correct 50-amp fuse is red.

from Recalled Component:

Identify How/When Recall Condition Production began manufacturing with the correct fuse on 6/22/2023.

was Corrected in Production:

#### **Recall Schedule:**

Description of Recall Schedule: Airstream will send dealer and owner notification letters once approved

by NHTSA.

Planned Dealer Notification Date: AUG 27, 2023 - AUG 27, 2023 Planned Owner Notification Date: AUG 27, 2023 - AUG 27, 2023

Part 573 Safety Recall Report	23V-454	Page 3
* NR - Not Reported		
The information contained in this report was submitted	d nursuant to 49 CER 8573	