

Part 573 Safety Recall Report

23V-498

Manufacturer Name : SPORTSMOBILE TEXAS, INC**Submission Date :** JUL 19, 2023**NHTSA Recall No. :** 23V-498**Manufacturer Recall No. :** NR**Manufacturer Information :****Population :**

Manufacturer Name : SPORTSMOBILE TEXAS, INC

Number of potentially involved : 13

Address : 9805 GRAY BLVD

Estimated percentage with defect : NR

AUSTIN TX 78758

Company phone : 512-835-4409

Vehicle Information :

Vehicle 1 : 2021-2021 Dodge Sportsmobile Pro Master

Vehicle Type : LIGHT VEHICLES

Body Style : VAN

Power Train : GAS

Descriptive Information : Sportsmobile manufactured a series of Class B RV units which has the Onan generators QG 2800i and 2800i EVAP installed. We were notified by Cummins that they were issuing a recall for the equipment.

Production Dates : MAR 03, 2020 - JAN 01, 2023

VIN Range 1 : Begin :

NR

End : NR

 Not sequential

Vehicle 2 : 2021-2022 Ford Sportsmobile Transit

Vehicle Type : LIGHT VEHICLES

Body Style : VAN

Power Train : GAS

Descriptive Information : Cummins is recalling the entire population of the subject model generator sets built until corrective action was implemented on 2/10/23 These generators are intended for use in recreational vehicles as were sold to recreational vehicle OEMS for installation as original equipment and directly to owners as aftermarket equipment Approximately 14799 of model Onan QG 2800i are included in the recall population. Note that the Number potentially involved provided below provides approximately 4000 units that do not contain defect, but Cummins is recalling the entire population because it is unable to identify them by generator set number

Production Dates : MAR 03, 2020 - JAN 31, 2023

VIN Range 1 : Begin :

NR

End : NR

 Not sequential

Description of Defect :

Description of the Defect : The fuel hose between the inline fuel filter and the injection pump module IPM may have inadequate damp force possibly resulting in gasoline leak

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : A gasoline leak in the presence of an ignition source may increase risk of fire

Description of the Cause : inadequate specification of fuel hose

Identification of Any Warning that can Occur : Bystanders may see or smell smoke

Involved Components :

Component Name 1 : Hose, Fuel

Component Description : Gasoline fuel hose between the IPM and fuel filter

Component Part Number : A064P026

Supplier Identification :**Component Manufacturer**

Name : Cummins Inc

Address : NR

NR

Country : NR

Chronology :

Cummins informed us of recall on April 13 2023. They received reports of fuel leaks on the Onan generators 2800

Description of Remedy :

Description of Remedy Program : Cummins is reaching out to vehicle owners to inform of recall and have each unit involved inspected and if defect exist, replace the fuel hose and associated clamps

How Remedy Component Differs from Recalled Component : The remedy fuel hose has a unique part number A073T925

Identify How/When Recall Condition was Corrected in Production : Production began with the remedy fuel hose on 2/21/23

Recall Schedule :

Description of Recall Schedule : Cummins notified OEM customers on 4/13/23. Cummins will then conduct recall including sending owner notifications 6/2/23

Planned Dealer Notification Date : NR - NR

Planned Owner Notification Date : NR - NR

* NR - Not Reported