

Part 573 Safety Recall Report

23V-501

Manufacturer Name : Jaguar Land Rover North America, LLC**Submission Date :** JUL 20, 2023**NHTSA Recall No. :** 23V-501**Manufacturer Recall No. :** H445**Manufacturer Information :****Population :**

Manufacturer Name : Jaguar Land Rover North America, LLC

Number of potentially involved : 3,134

Address : 100 Jaguar Land Rover Way

Estimated percentage with defect : 100 %

Mahwah NJ 07495

Company phone : 8188500

Vehicle Information :

Vehicle 1 : 2019-2019 JAGUAR XE

Vehicle Type : LIGHT VEHICLES

Body Style : 4-DOOR

Power Train : NR

Descriptive Information : Jaguar Land Rover is conducting a voluntary safety recall campaign involving all 2019MY Jaguar XE vehicles built at the Castle Bromwich and Solihull Vehicle Assembly PlantS from June 18, 2018 - July 9, 2019. 3134 vehicles in the United States and Federalized Territories. The basis for the recall population is all 19MY Jaguar XE vehicles with Rear Camera View and Navigation Pro specified.

Production Dates : JUN 18, 2018 - JUL 09, 2019

VIN Range 1 : Begin : SAJAT4GX6KCP43657 End : SAJAP4FE6KS487854

 Not sequential**Description of Noncompliance :**

Description of the Noncompliance : A concern has been identified on 19MY Jaguar XE vehicles with Rear Camera View and Navigation Pro specified, where the rear camera image display may become intermittent or permanently fail as a result of wiring damage in the trunk.

FMVSS 1 : 111 - Rear visibility

FMVSS 2 : NR

Description of the Safety Risk : In an intermittent or failed state the rear camera image display does not meet the requirements of FMVSS No. 111, Rear Visibility. Lack of display of the rear camera image may result in the driver being unaware of objects or pedestrians behind the vehicle increasing the risk of a crash.

Description of the Cause : NR

Identification of Any Warning that can Occur : NR

Involved Components :

Component Name 1 : Harness

Component Description : Harness

Component Part Number : KX73-14A005-Z*

Supplier Identification :**Component Manufacturer**

Name : LEONI WIRING SYSTEMS UK LIMITED (CBMP)

Address : Lower Milehouse Lane

Newcastle under Lyme Staffordshire Foreign States ST5 9BT

Country : United Kingdom

Chronology :

See File "Recall H445 Chronology".

Description of Remedy :

Description of Remedy Program : Vehicles will have the rear camera functionality and related camera harness in the trunk inspected. Where camera functionality OK and no harness damage is noted, cable clips will be replaced assuring cable routing is correct. Where damage to the wiring harness is found, the harness will be repaired and the cable retaining clips will be replaced to assure cable routing. There will be no charge to the owners for this repair. Customers who have paid for a repair of this defect will be reimbursed by the Jaguar Land Rover reimbursement plan, subject to the usual terms and conditions.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : Notifications to dealers will occur on August 3, 2023. Distribution of owner notification letters will occur on or before September 15, 2023.

Planned Dealer Notification Date : AUG 03, 2023 - AUG 03, 2023

Planned Owner Notification Date : SEP 15, 2023 - SEP 15, 2023

* NR - Not Reported