

Part 573 Safety Recall Report

23V-533

Manufacturer Name : Farber Specialty Vehicles**Submission Date :** JUL 31, 2023**NHTSA Recall No. :** 23V-533**Manufacturer Recall No. :** PG5215**Manufacturer Information :**

Manufacturer Name : Farber Specialty Vehicles

Address : 7052 Americana Parkway

Reynoldsburg OH 43068

Company phone : 800-331-3188

Population :

Number of potentially involved : 1

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2021-2021 FORD Transit

Vehicle Type : LOW VOLUME VEHICLES

Body Style : VAN

Power Train : GAS

Descriptive Information : Farber Specialty Vehicles is recalling one generator (Onan QG 2800i) that was installed in a specialty vehicle because the fuel hose between the inline fuel filter and the Injection Pump Module (IPM) may have inadequate clamp force, possibly resulting in a gasoline leak. Only one generator is included in the recall population. That was installed between 10/21 and 12/21.

Production Dates : OCT 04, 2021 - DEC 02, 2021

VIN Range 1 : Begin :

NR

End : NR

 Not sequential**Description of Defect :**

Description of the Defect : This fuel hose between the inline fuel filter and the Injection Pump Module (IPM) may have inadequate clamp force, possibly resulting in a gasoline leak.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : A gasoline leak in the presence of an ignition source may increase the risk of fire.

Description of the Cause : The cause of the issue is an inadequate specification of the fuel hose.

Identification of Any Warning that can Occur : Bystanders may see or smell gasoline.

Involved Components :

Component Name 1 : Hose, Fuel

Component Description : Gasoline fuel hose between the IPM and fuel filter

Component Part Number : A064P026

Supplier Identification :

Component Manufacturer

Name : Cummins, Inc.

Address : Box 3005

Mail Code COB118 Columbus Indiana 47202-3004

Country : United States

Chronology :

Cummins, Inc. notified Farber of Manufacturer Recall No. : PG5215 and NHTSA Recall No. : 23E-030 on or about April 13, 2023.

Description of Remedy :

Description of Remedy Program : The remedy is to inspect and, if the unit has the defect, to replace the subject fuel hose and associated clamps. A recall-specific reimbursement plan will be provided on the Recall Portal for those units not covered by the manufacturer's limited warranty.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : NR

Planned Dealer Notification Date : NR - NR

Planned Owner Notification Date : AUG 15, 2023 - AUG 15, 2023

* NR - Not Reported