Part 573 Safety Recall Report

Manufacturer Name :Airstream, Inc.Submission Date :SEP 01, 2023NHTSA Recall No. :23V-614Manufacturer Recall No. :NR

Manufacturer Information :

Manufacturer Name : Airstream, Inc.

Address : 419 West Pike Street PO Box 629 Jackson Center OH 45334-0629 Company phone : 937-596-6111

Vehicle Information :

Vehicle 1:	2021-2023 Airstream 16' Basecam & 20' Basecamp	
Vehicle Type :	TRAILERS	
Body Style :	UNKNOWN	
Power Train :	NR	
Descriptive Information :	The affected models were manufactured without a rooftop mounted air conditioner installed. These units are built with a 12-gauge wire installed for future air conditioner installation.	
Production Dates :	JAN 01, 2021 - JAN 05, 2023	
VIN Range 1:	Begin :1SMG4DD26MJ204885End :1SMG4DD25PJ20846Image: Not sequential	

Description of Defect :

Description of the Defect :	The Basecamp trailers manufactured without the roof mounted air conditioner installed, has a 12 gauge wire is run for future air conditioner installation. Code requires this wire to be capped and terminated inside of a junction box. This wire was capped using a Wago connector but not terminated inside of a junction box.
FMVSS 1 :	NR
FMVSS 2 :	NR
Description of the Safety Risk :	If the air conditioner "prep wire" were to separate from the Wago connector, there is a potential of a "hot skin" scenario. This increases the risk of personal injury and/or property damage.
Description of the Cause :	A personal change occurred and this requirement was not properly communicated.
Identification of Any Warning that can Occur :	None



Number of potentially involved :

Estimated percentage with defect : 100 %

Population :

58

23V-614

Part 573 Safety Recall Report

Involved Components :

Component Name 1 : Junction Box

Component Description : Junction Device, Self Contained

Component Part Number: 512025-01

Supplier Identification :

Component Manufacturer

Name: NR

Address : NR NR Country : NR

Chronology:

8/23/2023 - Airstream identifies the "prep wire" defect during an audit.

8/24/2023 - Airstream begins an investigation.

8/25/2023 - The origin for this defect is determined.

8/28/2023 - The safety committee meets and reviews all known data and determines a recall is warranted. Airstream is unaware of any warranty or injury claims due to this issue.

Description of Remedy :

Description of Remedy Program :	Dealers will be instructed to remove the wire from the circuit breaker and power converter. This will be done at no cost to the owner.
	Any Basecamp trailer manufactured without the roof mounted air conditioner installed after 8/24/2023 has the "prep wire" properly capped and terminated inside of a junction box.
0	The condition was corrected when production re-implemented the installation of the junction box for the air conditioner "prep wire" for Basecamps manufactured without the optional rooftop air conditioner.

Recall Schedule :

Description of Recall Schedule : Airstream will send dealer and owner notification letters once approved by NHTSA.

The information contained in this report was submitted pursuant to 49 CFR §573

Part 573 Safety Recall Report

23V-614

Planned Dealer Notification Date :OCT 31, 2023 - OCT 31, 2023Planned Owner Notification Date :OCT 31, 2023 - OCT 31, 2023

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR §573