OMB Control No.: 2127-0004

# Part 573 Safety Recall Report

# 23V-701

Manufacturer Name : Alliance RV, LLC
Submission Date : OCT 30, 2023
NHTSA Recall No. : 23V-701

Manufacturer Recall No.: n/a, will use yours



#### **Manufacturer Information:**

Manufacturer Name: Alliance RV, LLC

Address: 301 Benchmark Drive

Elkhart IN 46516

Company phone: 1-574-218-7165

# **Population:**

Number of potentially involved : 3,390 Estimated percentage with defect :  $100\,\%$ 

#### **Vehicle Information:**

Vehicle 1: 2021-2023 Paradigm & Valor

295MK;310RL;340RL;365RD;370FB;372RK;382RK;385FL;390MP;395DS;36A15;36V

11;37V13;40V13;41V15;42V13;43V13

Vehicle Type: TRAILERS Body Style: OTHER Power Train: NR

Descriptive Information: Recalled products will have 2 or more solar panels installed from the factory with a

twist on wire cap/nut connecting the solar port to the solar charge lines

Production Dates: FEB 03, 2020 - NOV 01, 2022

#### **Description of Defect:**

Description of the Defect: A wire cap/nut used to connect the solar port to the solar charge lines may

loosen over time and need attention in the form of replacing the connector.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: A loose connection could cause heat at the connection point of the solar port

and solar charge lines. this could compromise the wire insulation / jacket

and lead to a thermal event.

Description of the Cause: A loosened connection of the solar port wires to the solar charge lines.

Identification of Any Warning Diminished performance, failure to perform and/or a thermal event.

that can Occur:

#### **Involved Components:**

Component Name 1: NR Component Description: NR Component Part Number: NR

## **Supplier Identification:**

## **Component Manufacturer**

Name: NR Address: NR

NR

Country: NR

## **Chronology:**

A public social mead post and private messaged received on 10/3/2023 prompted further investigation into this topic. The potential risk lead to the determination to initiate a safety recall.

#### **Description of Remedy:**

Description of Remedy Program: The remedy will be to address the connection point from the solar panel

port to the solar charge lines. Alliance RV will be providing new

connectors and will be paying labor (no charge at all to retail consumers)

to have this inspection and remedy performed.

How Remedy Component Differs A remedied component will be a connection that has been inspected and

from Recalled Component: the connectors replaced with a new style connector to prevent loosening

from being a possibility.

Identify How/When Recall Condition Over time, the connection point evolved from a wire nut/cap to a newer

was Corrected in Production: style connector.

#### **Recall Schedule:**

Description of Recall Schedule: We are currently running the mail merge to be able to print the

notifications for distribution. While we have 12/19/2023 slotted, we will

be ahead of time for getting these notifications out. We should have them

completed this week.

Planned Dealer Notification Date: DEC 19, 2023 - DEC 19, 2023 Planned Owner Notification Date: DEC 19, 2023 - DEC 19, 2023

Part 573 Safety Recall Report	23V-701	Page 3
* NR - Not Reported		
The information contained in this report was submitted	pursuant to 49 CFR 8573	