RECALL 24V029 / 2024-020 REMEDY INSTRUCTIONS



Make(s): MANY, SEE BELOW Model(s): MANY, SEE BELOW

Model Year(s): MANY, SEE BELOW

Concern:

The fasteners that attach the independent suspension to the chassis may not be adequately torqued.

Repair Code: RC-006-09-00-004478 Allotted Time: 1.00 HRS. PER AXLE

Inspection Code: N/A Allotted Time: N/A Photo(s) Required: NO

Prior Authorization Required: NO Part(s) Kit Number: F100508476

Part(s) Return: NO

Turn off LP Gas at LPG Tank(s). Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

CERTAIN 2023 IBEX: BXT10LHG & BXT19RBM

CERTAIN 2023 – 2024 IBEX: BXT10LHRK, BXT19MBH, BXT19MSB, BXT19QBH, BXT19QBS, BXT19QTH, BXT20BHS, BXT20MDS\, BXT23RLDS & BXT24MTH

CERTAIN 2023 – 2024 NOBO: NBT10.6, NBT10.7, NBT16.1, NBT16.6, NBT19.1, NBT19.2, NBT19.3, NBT19.5, NBT19.6, NBT19.8, NBT20.3 & NBT20.4

CERTAIN 2023 R. POD: RPT171 & RPT190

CERTAIN 2023 - 2024 R. POD: RPT153, RPT180, RPT192, RPT193, RPT196, RPT201, RPT202 & RPT203

STEP 1: LOCATE THE SIX NUTS AND BOLTS THAT ATTACH THE INDEPENDENT SUSPENSION TO THE CHASSIS;

- 3 NUTS AND BOLTS PER SIDE, PER AXLE;
- MAY HAVE TO REMOVE FOAM SEALANT TO GAIN ACCESS TO THE NUTS AND BOLTS AS NEEDED;
- IF ANY OF THE FASTENERS (BOLTS/NUTS) ARE MISSING, CONTACT THE PLANT TO HAVE REPLACEMENTS SENT;
 - o F100508476 IS THE PART NUMBER FOR THE NUT AND BOLT TO ORDER AS NEEDED;

STEP 2: ENSURE THE BOLT IS PROPERLY SEATED, IF NOT, SEAT THE BOLT HEAD

• DO NOT USE THE NUT TO "PULL" THE BOLT INTO THE CHASSIS;

STEP 3: TORQUE THE NUTS TO 100 FT.-LBS.;

ENSURE THAT A BACKER WRENCH OR SOCKET IS USED ON THE BOLT HEAD WHEN TORQING:

STEP 4: RE-FOAM/SEAL THE AREA AS NEEDED:

STEP 5: CLAIM REPAIR CODE.