

#### Toyota Motor Engineering & Manufacturing North America, Inc.

Vehicle Safety & Compliance Liaison Office 19001 South Western Avenue Torrance, CA 90501

August 31, 2017

# NONCOMPLIANCE INFORMATION REPORT

#### 1. <u>Vehicle Manufacturer Name</u>:

Toyota Motor Corporation ["TMC"] 1, Toyota-cho, Toyota-shi, Aichi 471-8571, Japan

Affiliated U.S. Sales Company

Toyota Motor Sales, USA, Inc. ["TMS"] 19001 South Western Avenue, Torrance, CA 90501

#### Manufacturer of front airbags

Toyoda Gosei Co., Ltd. Haruhi Plant 1 Haruhinagahata Kiyosu, Aichi, 452-8564, Japan

#### 2. <u>Identification of Involved Vehicles and Affected Components:</u>

Based on production records, we have determined the involved vehicle population to be the vehicles listed in the table below.

Make/Car Line	Model Year	Manufacturer	Production Period
Toyota Land Cruiser	2008 - 2016	TMC	September 4, 2007 – November, 12, 2015
Lexus LX	2006 - 2013	TMC	May 7, 2005 – February 26, 2013

#### VINs of involved vehicles

Make/Car Line	VIN		
Toyota Land Cruiser	JTMHY05J084000131, JTMHY05J184000123, JTMHY05J984000533, JTMHY05J884000569, JTMHY05J184000509, JTMHY7AJ7F4028665, JTMCY7AJ1G4039317, JTMCY7AJ9G4039307		
Lexus LX	JTJHT00W564003120, JTJHT00W564005207, JTJHT00W264010736, JTJHY00W984000113, JTJHY00W184000770, JTJHY00W884015007, JTJHY00W794023102, JTJHY00W394024005, JTJHY00W294028644, JTJHY00W594028623, JTJHY00W394028541, JTJHY7AX6B4060373, JTJHY7AX8D4119605		

Applicability	Part Number	Part Name	Component Description
MY2008 – MY2016 Toyota Land Cruiser	45130-60390 45130-60500 45130-60570	Pad Assy. Steering Wheel	Driver Airbag
MY2006 – MY2013 Lexus LX	45130-60331 45130-60410	Steering wheel	
	73960-60170	Airbag Assy. Instrument Panel Passenger	Front Passenger Airbag

- Note: (1) Based on a review of production records, Toyota was able to identify specific vehicles affected by this issue; other Toyota and Lexus vehicles were confirmed to be equipped with correct specification airbags.
- 3. <u>Total Number of Vehicles Involved:</u>

Total : 21

4. <u>Percentage of Vehicles Estimated to Actually Experience Noncompliance:</u>

100%

#### 5. <u>Description of Noncompliance</u>:

In the subject vehicles, there is a possibility that an incorrect specification driver or front passenger airbag assembly was installed during the vehicle assembly process. This could result in an airbag deployment in a manner other than as designed in the event of a crash which would cause the airbags to deploy. As a result, some requirements of FMVSS No. 208 may not be met, resulting in an increased risk of injury during a crash.

#### 6. <u>Test Results and Other Information</u>:

On February 17, 2017, Toyota filed a Foreign Recall Report concerning a recall in Japan covering certain Toyota Corolla Rumion vehicles which may have received an incorrect specification airbag at the production plant. Subsequently, Toyota checked records of airbags installed in other vehicles produced after 2002. As a result, Toyota discovered that incorrect specification driver or front passenger airbag assemblies may have been installed in 21 vehicles of the above mentioned models in the U.S. market. After considering the differences between the correct and incorrect specification airbags, Toyota decided on August 25, 2017, that it is possible that vehicles with an incorrect specification airbag may not meet some of requirements of FMVSS No. 208.

## 7. <u>Description of Corrective Repair Action:</u>

All known owners of the subject vehicles will be notified by first class mail to return their vehicles to a Toyota or Lexus dealer. The dealers will replace the airbag assembly with a correct one at no cost.

#### Reimbursement Plan for pre-notification remedies

The owner letter will instruct vehicle owners who have paid to have this condition remedied prior to this campaign to seek reimbursement pursuant to Toyota's or Lexus's General Reimbursement Plan.

## 8. <u>Recall Schedule</u>:

Notifications to owners of the affected vehicles will occur by late September, 2017. A copy of the draft owner notification letter(s) will be submitted as soon as available.

## 9. <u>Distributor/Dealer Notification Schedule</u>:

Notifications to distributors/dealers will be sent on August 31, 2017. Copies of dealer communications will be submitted as they are issued.

#### 10. <u>Manufacturer's Campaign Number:</u>

Toyota's Campaign Number: H0S Lexus' Campaign Number: HLD