

GLOBAL SAFETY FIELD INVESTIGATIONS
DCS5548
URGENT - DISTRIBUTE IMMEDIATELY

Date: October 20, 2020

Subject: N202314260 - Service Update
Open Hood Message

Models: 2020 Chevrolet Corvette

To: All General Motors Dealers

General Motors is releasing Service Update N202314260 today. The total number of U.S. vehicles involved is approximately 7,574. Please see the attached bulletin for details.

Global Warranty Management (GWM)

The Required Field Action section on the Investigate Vehicle History (IVH) screen will be updated October 21, 2020 or sooner. A list of involved vehicles in dealer new inventory is attached to this message. Please hold all warranty transactions until IVH has been updated.

END OF MESSAGE

GLOBAL SAFETY FIELD INVESTIGATIONS

Service Update

N202314260 Open Hood Message



Release Date: October 2020

Revision: 00

Attention: This service update includes vehicles in dealer inventory and customer vehicles that return to the dealership for any reason. This bulletin will expire at the end of the involved vehicle's New Vehicle Limited Warranty period.

Make	Model	Model Year		RPO	Description
		From	To		
Chevrolet	Corvette	2020	2020		

Involved vehicles are marked "open" on the Investigate Vehicle History screen in GM Global Warranty Management system. This site should always be checked to confirm vehicle involvement prior to beginning any required inspections and/or repairs.

Condition	Certain 2020 model year Chevrolet Corvette vehicles may have a condition when the front trunk is open and the vehicle speed is above 1.8 mph / 3 km/h the DIC message may indicate "Hood Open Speed Limited to 26 MPH" or "Hood Open Speed Limited to 82 MPH" depending on the level of software present in the vehicle
Correction	Dealers will reprogram the instrument panel cluster control module.

Parts

No parts are required for this repair.

Warranty Information

Labor Operation	Description	Labor Time	Trans. Type	Net Item
9105257*	Verified Module Software or Calibration Level: Module Is Programmed with Same Level Software or Calibration	0.2	ZFAT	N/A
9105258*	Instrument Panel Cluster Control Module and Graphics Reprogramming with SPS	0.6		

*** Important:** To avoid warranty transaction rejections, carefully read and follow the instructions below:

- The Warranty Claim Code must be accurately entered in the "Warranty Claim Code" field of the transaction.
- When more than one Warranty Claim Code is generated for a programming event, it is required to document all Warranty Claim Codes in the "Correction" field on the job card. Dealers must also enter one of the codes in the "Warranty Claim Code" field of the transaction, otherwise the transaction will reject. It is best practice to enter the FINAL code provided by SPS/SPS2.

Warranty Claim Code Information Retrieval

If the Warranty Claim Code was not recorded on the Job Card, the code can be retrieved in the SPS system as follows:

1. Open TLC/TIS on the computer used to program the vehicle.
2. Select and start SPS/SPS2.
3. Select Settings.
4. Select the Warranty Claim Code tab.

The VIN, Warranty Claim Code and Date/Time will be listed on a roster of recent programming events. If the code is retrievable, dealers should resubmit the transaction making sure to include the code in the SPS Warranty Claim Code field.

Service Procedure

Caution: Before downloading the update files, be sure the computer is connected to the internet through a network cable (hardwired). DO NOT DOWNLOAD or install the files wirelessly. If there is an interruption during programming, programming failure or control module damage may occur.

Note: Carefully read and follow the instructions below.

- Ensure the programming tool is equipped with the latest software and is securely connected to the data link connector. If there is an interruption during programming, programming failure or control module damage may occur.
- Stable battery voltage is critical during programming. Any fluctuation, spiking, over voltage or loss of voltage will interrupt programming. Install a GM Authorized Programming Support Tool to maintain system voltage. Refer to

Service Update

N202314260 Open Hood Message



www.gmdesolutions.com for further information. If not available, connect a fully charged 12V jumper or booster pack disconnected from the AC voltage supply. DO NOT connect a battery charger.

- Ensure the ignition is turned OFF, load on the vehicle's battery such as; interior lights, exterior lights (including daytime running lights), HVAC, etc. may affect the download process.
- Clear DTCs after programming is complete. Clearing powertrain DTCs will set the Inspection/Maintenance (I/M) system status indicators to NO.

The screenshot shows the Techline Connect software interface. At the top, it displays 'Techline Connect Version: 1.6.0 Validation' and '2021 • Chevrolet • Camaro'. The main window is titled 'Electronic Brake Control Module - Programming'. It contains a table with columns for Controller, ID, Current #, and Description. A modal dialog box is overlaid on the table, displaying the message: 'M4521: You are attempting to reprogram with the same calibration. Select OK to continue, Cancel to Stop!'. The dialog has 'OK' and 'Cancel' buttons. Below the table, there are buttons for 'Print', 'Save to PDF', 'ECU Data', 'Back', 'Start Programming', and 'Cancel'. The VIN '5644477' is visible at the bottom right of the interface.

Controller	ID	Current #	Description
K17	1	84820771	
K17	2	84820790	
K17	3	84820797	84820797 Electronic Brake Diagnostic Calibration
K17	4	84820801	84820801 Function Enable Calibration
K17	5	84820808	84820808 Driver mode brake calibration
K17	6	84820819	84820819 Tire Pressure Calibration
K17	7	84820825	84820825 Caliper Assist Calibration

The screenshot shows the Service Programming System software interface. The main window is titled 'Summary' and displays a table for the 'Brake System Control Module'. The table has columns for Controller, Id, Current #, Selected #, and Description. A modal dialog box is overlaid on the table, displaying the message: 'M4521: You are attempting to reprogram with the same calibration. Select OK to continue, Cancel to Stop!'. The dialog has 'OK' and 'Cancel' buttons. Below the table, there is a 'Vehicle Data' section with columns for Attribute and Value. At the bottom, there are buttons for 'Print', '< Back', 'Next >', and 'Cancel'. The VIN '3GTU9DET7LG100114' is visible at the bottom right of the interface.

Controller	Id	Current #	Selected #	Description
K160	1	84758789	84758789	New software for start of production
	2	84790857	84790857	New calibration for start of production
	4	84557555	84557555	Function Enable Calibration
	5	84681582	84681582	Updated Calibration to improve diagnostics for DTCs C05B0 and C058E.
	7	84690692	84690692	Caliper Assist Calibration
	8	84662691	84662691	
	9	84678464	84678464	

5644477

5431207

Service Update

N202314260 Open Hood Message




Important: Techline Connect and TIS2WEB screens shown above.

Important: If the same calibration/software warning is noted on the TLC or SPS Summary screen, select OK and follow screen instructions. After a successful programming event, the WCC is located in the Service Programming System dialogue box of the SPS Summary screen. No further action is required. Refer to the Warranty section of the bulletin.

Important: When programming a module in GM's new Vehicle Intelligence Platform, or VIP, the power mode (ignition) needs to be off or errors may occur. This involves the 2020 Chevrolet Corvette, Cadillac CT5 and CT4, as well as the upcoming full-size Chevrolet, GMC, Cadillac SUVs and Buick Envision. Serial Data Message Authentication also needs to have the ignition off.

Important: Graphics Programming must be performed when reprogramming the instrument panel cluster.


1. Reprogram the instrument panel cluster. Refer to *P16 Instrument Panel Cluster Control Module: Programming and Setup* in SI.

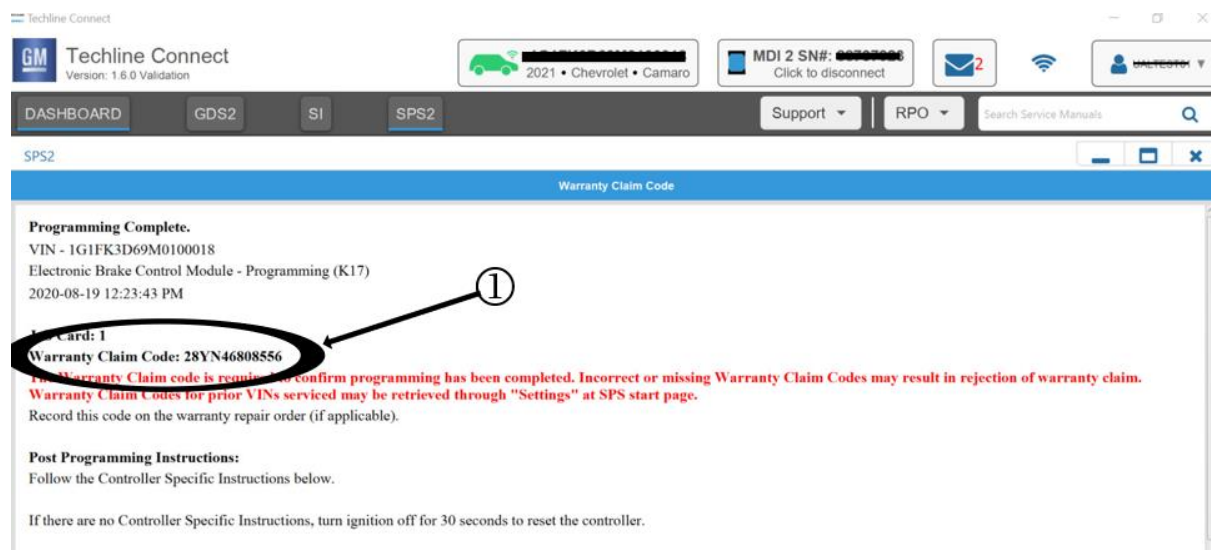

5644478

Service Update

N202314260 Open Hood Message

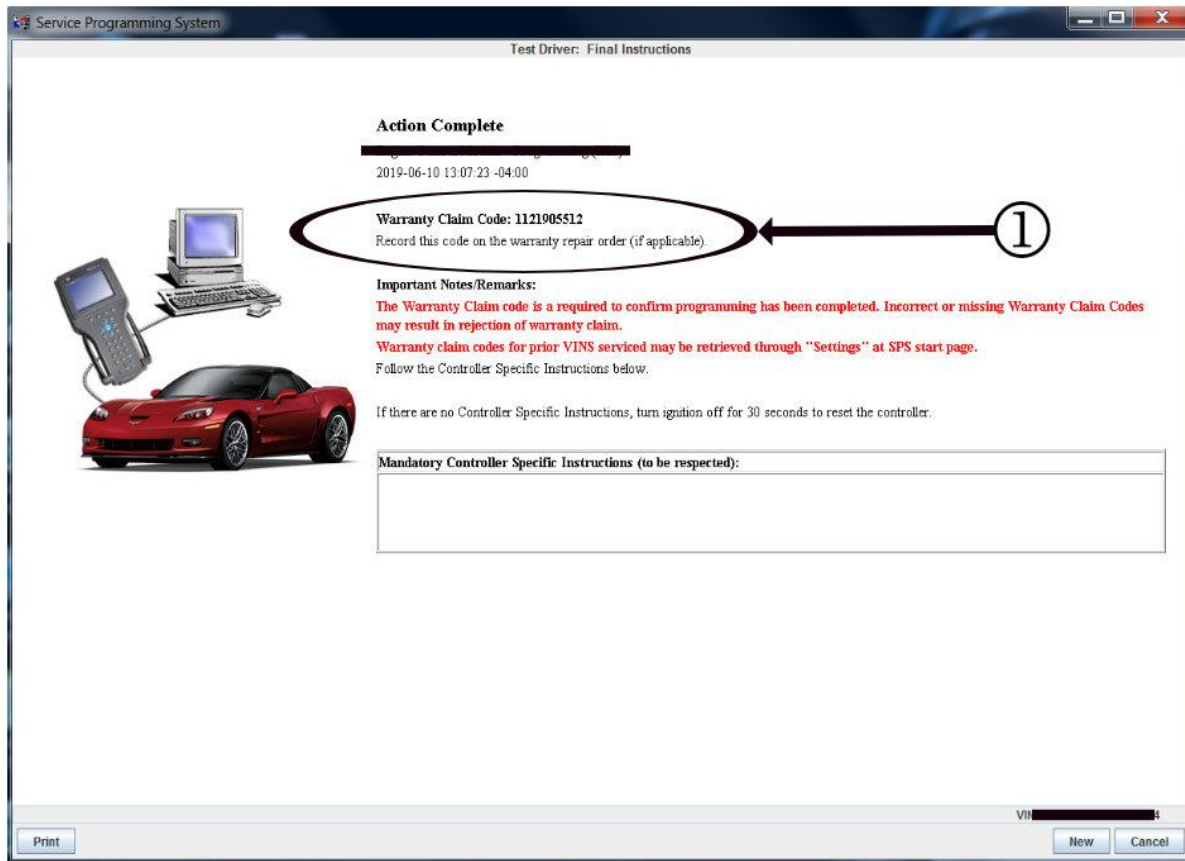

5431209

Important: To avoid warranty transaction rejections, you **MUST** record the warranty claim code provided on the Warranty Claim Code (WCC) screen shown above on the job card. Refer to callout 1 above for the location of the WCC on the screen.

- Record SPS Warranty Claim Code on job card for warranty transaction submission.

Dealer Responsibility

Whenever a vehicle subject to this service update enters your vehicle inventory or is in your facility for service in the future, and the vehicle is still covered under the New Vehicle Limited Warranty, you must take the steps necessary to be sure the service update correction has been made before selling or releasing the vehicle.

All new, used, GM Certified Used, courtesy transportation vehicles, dealer shuttle vehicles, etc. in dealers' possession and subject to this bulletin must be held and inspected/repared per the service procedure of this bulletin before customers take possession of these vehicles. Involved vehicles must be held and not delivered to customers, dealer-traded, released to auction, used for demonstration, or any other purpose.

All GM Certified Used vehicles currently in the dealers' inventory within the Certified Pre-Owned Inventory System (CPOIS) will be de-certified and must be held and remedied per the service procedure in this bulletin. Upon submitting an accepted/paid warranty transaction in the Global Warranty Management (GWM) system, the vehicle can be re-certified for sale within the CPOIS system, or once again be used in the CTP program.

Service Update

N202314260 Open Hood Message



Dealer Reports

The Inventory tab of the Open Vehicle Report will contain Service Update Bulletin VINs that apply to this field action. This information is intended to assist dealers with the **PROMPT COMPLETION** of these vehicles. The Customer In-Service tab will not contain Service Update Bulletin VIN data because the intent of a Service Update Bulletin is to not inconvenience a customer with a special trip for service. Service Update Bulletins are to be completed when the customer is in for a regularly scheduled visit.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the tools, equipment, safety instructions, and know-how to do a job properly and safely. If a condition is described, **DO NOT** assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your dealer for information on whether your vehicle may benefit from the information.



**We Support
Voluntary Technician
Certification**