Service Update

N222372540 Spare Wheel Heat Shield Retainers Missing



Release Date: October 2022 Revision: 00

Attention: This service update includes vehicles in dealer inventory and customer vehicles that return to the dealership for any reason. This bulletin will expire at the end of the involved vehicle's New Vehicle Limited

Warranty period.

		Model Year					
Make	Model	From	То	RPO	Description		
Chevrolet	Silverado 1500 New	2022	2022	N10	EXHAUST SYSTEM-DUAL		
GMC	Sierra 1500 New	2022	2022	INTO	EXHAUST STSTEM-DUAL		

Involved vehicles are marked "Open" on the Investigate Vehicle History screen in GM Global Warranty Management system. This site should always be checked to confirm vehicle involvement prior to beginning any required inspections and/or repairs.

Condition	Certain 2022 model year Chevrolet Silverado 1500 and GMC Sierra 1500 vehicles were built without		
	spare wheel heat shield retainers between the frame and the spare tire housing/shield.		
Correction	Dealers will install the missing spare wheel heat shield retainers.		

Parts

Quantity	Part Name	Part No.
2	Spare Wheel Heat Shield Retainer	84913927

Note: Use the VIN and the GM Electronic Parts Catalog (EPC) to determine which Spare Wheel Heat Shield Retainer to order

Reminder: Parts may be removed from Retail Inventory Management (RIM). Dealers should review the affected parts to confirm RIM managed status. Parts may have quantity limiters in effect.

Warranty Information

Labor		Labor	Trans.	Net
Operation	Description	Time	Type	Item
9106454	Install Spare Wheel Heat Shield Retainers	0.4	ZFAT	N/A

Service Procedure

Important: Service Agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

1. Raise and support the vehicle. Refer to Lifting and Jacking the Vehicle in SI.




5646467

- 2. Remove the Spare Wheel Lock Cylinder (1).
- 3. Remove the spare tire.


Service Update

N222372540 Spare Wheel Heat Shield Retainers Missing



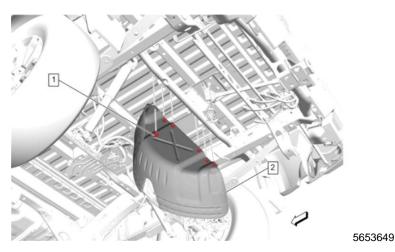


- 4. Remove the 6 Spare Wheel Heat Shield Bolts (1).
- 5. Remove the Spare Wheel Heat Shield (2).

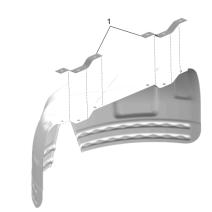

6144689

6. Install the 2 Spare Wheel Heat Shield Retainers (1).

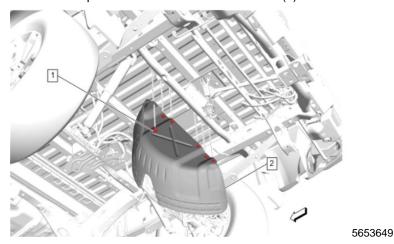

- 7. Install the Spare Wheel Heat Shield (2).
- 8. Install and tighten the 6 Spare Wheel Heat Shield Bolts (1) to 22 Nm (16 lb ft).
- 9. Install the Spare Tire.

Service Update

N222372540 Spare Wheel Heat Shield Retainers Missing





5646467

- 10. Install the Spare Wheel Lock Cylinder (1).
- 11. Lower the vehicle. Refer to Lifting and Jacking the Vehicle in SI.

Dealer Responsibility

Whenever a vehicle subject to this service update enters your vehicle inventory or is in your facility for service in the future, and the vehicle is still covered under the New Vehicle Limited Warranty, you must take the steps necessary to be sure the service update correction has been made before selling or releasing the vehicle.

All new, used, GM Certified Used, courtesy transportation vehicles, dealer shuttle vehicles, etc. in dealers' possession and subject to this bulletin <u>must</u> be held and inspected/repaired per the service procedure of this bulletin <u>before</u> customers take possession of these vehicles. Involved vehicles must be held and not delivered to customers, dealer-traded, released to auction, used for demonstration, or any other purpose.

All GM Certified Used vehicles currently in the dealers' inventory within the Certified Pre-Owned Inventory System (CPOIS) will be de-certified and must be held and remedied per the service procedure in this bulletin. Upon submitting an accepted/paid warranty transaction in the Global Warranty Management (GWM) system, the vehicle can be re-certified for sale within the CPOIS system, or once again be used in the CTP program.

Dealer Reports – For USA & Export

The Inventory tab of the Open Vehicle Report will contain Service Update Bulletin VINs that apply to this field action. This information is intended to assist dealers with the **PROMPT COMPLETION** of these vehicles. The Customer In-Service tab will not contain Service Update Bulletin VIN data because the intent of a Service Update Bulletin is to not inconvenience a customer with a special trip for service. Service Update Bulletins are to be completed when the customer is in for a regularly scheduled visit.

GLOBAL SAFETY FIELD INVESTIGATIONS DCS6300 URGENT - DISTRIBUTE IMMEDIATELY

Date: October 4, 2022

Subject: N222372540 - Service Update

Spare Wheel Heat Shield Retainers Missing

Models: 2022 Chevrolet Silverado 1500 New

2022 GMC Sierra 1500 New

Equipped with EXHAUST SYSTEM-DUAL (RPO N10)

To: All General Motors Dealers

General Motors is releasing Service Update N222372540 today. The total number of U.S. vehicles involved is approximately 5,200. Please see the attached bulletin for details.

Global Warranty Management (GWM)

The Required Field Action section on the Investigate Vehicle History (IVH) screen will be updated October 4, 2022. A list of vehicles in dealer inventory is attached to this message.

END OF MESSAGE
GLOBAL SAFETY FIELD INVESTIGATIONS