

SSM 46723	Some 2015-2016 MKC vehicles without active park assist and built on or before 2/15/16 may exhibit steering column controls such as turn signals, radio controls, and low speed wipers being intermittently inoperative due to lack of communication. Wake up the steering column control module (SCCM) by actuating the headlight flash to pass function and reprogram the SCCM with latest calibration using IDS release 106.03 or higher. Make sure you are connected to the internet when entering module programming to obtain the latest updates. Calibration files may also be obtained at <a href="http://www.motorcraftservice.com">www.motorcraftservice.com</a> . Use causal part 3F791 and refer to section 10 body/chassis/electrical in the SLTS manual for applicable labor operations.
--------------	---