

SSM 47123	Some 2015-2017 Transit vehicles may fail to program the BCM following replacement. To repair, follow BCM installation procedures in Workshop Manual (WSM), Section 419-10 using Integrated Diagnostic System (IDS) or Ford J2534 Diagnostic Software (FJDS) release 108.06 or higher. Make sure you are connected to the internet when entering module programming to obtain the latest updates. Calibration files may also be obtained at www.motorcraftservice.com . Disregard DTC U0264 in the BCM and DTC U0010 in the Image Processing Module B (IPMB) if no observable rear parking aid camera concerns are present. For claiming this programming procedure, use causal part 15604 and applicable labor operations in Section 10 of the Service Labor Time Standards (SLTS) Manual.
--------------	---