

| | |
|--------------|---|
| SSM 47467 | Some 2017-2018 Escape vehicles equipped with a 1.5L or 2.0L engine may exhibit fuse F34 open, an illuminated MIL with diagnostic trouble codes (DTCs) P0034, P023A, P0245, P0480, P0481, P0645, P06A0, P06DB, P188D, P02602, and/or P2681 in the powertrain control module (PCM). May also exhibit an all-wheel drive (AWD) fault warning and/or traction control (TC) light on. Inspect the 14290 wiring harness at the battery junction box (BJB) under the air cleaner and/or the brake vacuum pump for wiring harness retainers not installed correctly allowing chafing to occur at multiple points. Repair damaged wiring as required. Refer to the Wiring Diagram for repair information. For claiming, use causal part 14290 and applicable labor operations in section 10 of the service labor time standards (SLTS) manual. |
|--------------|---|