

MFR Communication ID	MFR Communication Date	Make (Brand)	Model	Model Year	Text
SSM 47845	3/5/2019	Ford	Mustang	2015	Some 2015-2019 Mustang vehicles may exhibit a concern of no horizontal movement of the front power seats. This may be caused by a defective seat track motor or separation of the drive motor cable from the seat track. The seat track motor assembly is available separately (14547) and replacement of the complete seat frame assembly (9661711) may not be required. Refer to Workshop Manual, Section 501-10A for seat track motor removal.
				2016	
				2017	
				2018	
				2019	