

MFR Communication ID	MFR Communication Date	Make (Brand)	Model	Model Year	Text
SSM 47879	3/19/2019	Ford	Explorer	2016	Some 2016-2019 Police Interceptor Utility vehicles may exhibit flickering front amber marker lamps (inboard amber lights under the headlamps) when the engine is running. Before attempting repairs, verify the frequency selection using the latest level of the appropriate Ford scan tool. Go to Module Programming > Programmable Parameters > Police Mode > Frequency Type, and verify Type 2 is selected. The engine must be running for the configuration to complete if this parameter is changed.
				2017	
				2018	
				2019	