

SSM 48018 - 2015-2019 Transit - Front Door Power Window And/Or Power Lock Inoperative - C339 And C340 Pigtails Available As A Lower Level Service Part

Some 2015-2019 Transit vehicles may exhibit inoperative power door locks and/or power windows due to water intrusion in the door to body harness connector C339(left) or C340 (right). If corrosion is found, service pigtails JU2Z-14S411-RA (gray) and JU2Z-14S411-PA (black) are released to service the body harness (female) side of the connector, without replacing the entire 14401 body harness. Service the pigtail(s) and replace the door harness as needed, while making sure the door to body accordion grommet ends and surrounding body plugs are properly seated to prevent future water intrusion. For claiming use causal part 14631 and applicable labor operations in Section 10 of the Service Labor Time Standards (SLTS) Manual.

APPLICABLE VEHICLES
2015 - 2019 TRUCK: TRANSIT