

SSM 48070 - 2008-2019 Various Ford/Lincoln/Mercury Vehicles - Inoperative Heating, Ventilation, And Air Conditioning (HVAC) Blower Motor

Some 2009-2017 Expedition/Navigator, 2009-2014 F-150/Mustang, 2008-2009 Sable, 2008-2019 Taurus/Flex/MKT, 2013-2019 Police Interceptor Sedan/Utility, and 2011-2019 Explorer vehicles may exhibit inoperative or intermittent HVAC blower motor function at various fan speed settings. This may be due to a poor electrical connection at the blower motor speed control. If the blower motor speed control is determined to be the causal part, replacement of the electrical connector pigtail harness (14S411) to the blower motor speed control is also recommended to avoid repeat repairs. Use pigtail harness service part numbers 3U2Z-14S411-ZEA or CU2Z-14S411-FA, as both parts are interchangeable. Refer to Wiring Diagram, Cell 5 for recommended splicing procedures.

APPLICABLE VEHICLES

2009 - 2017 EXPEDITION
2011 - 2019 EXPLORER
2009 - 2017 NAVIGATOR
2009 - 2014 F150/LINCOLN MARK LT
2009 - 2014 MUSTANG
2008 - 2009 FIVE HUNDRED/MONTEGO/TAURUS/SA
2008 - 2009 FIVE HUNDRED/MONTEGO/TAURUS/SA
2009 - 2019 FLEX
2010 - 2019 MKT
2010 - 2019 TAURUS