

SSM 48073 2018 TRANSIT CONNECT - CHR AND GNSS - VEHICLE LOCATOR FUNCTION INOPERATIVE - BUILT ON 29-MAR-2018 AND THROUGH 4-AUG-2018

Some 2018 Transit Connect vehicles built on 29-Mar-2018 and through 4-Aug-2018 and equipped with connected human machine interface (HMI) radio (CHR) and global navigation satellite system (GNSS), may exhibit the vehicle locator function not working on the FordPassmobile application. To correct this condition, perform programmable module installation (PMI) on the audio control module (ACM) and when asked if the original module is installed select NO. This procedure will retrieve the updated as-built from the database and install it into the module. For claiming, use causal part 18C869 and applicable labor operations in Section 10 of the Service Labor Time Standards (SLTS) Manual.

APPLICABLE VEHICLES
2018 Transit Connect