

**SSM 48423 - 2015-2020 Various Vehicles - Illuminated Malfunction Indicator Lamp (MIL) With Variable Cam Timing (VCT) DTCs - Diagnostic Information**

Some 2015-2020 Ford and Lincoln vehicles may exhibit an illuminated MIL with diagnostic trouble codes (DTCs) P0011, P0012, P0014, P0015, P0016, P0017, P0018, P0019, P0021, P0022, P0024 and/or P0025. This may be due to small debris causing the VCT solenoid to stick. Before attempting any component diagnosis or replacement of the VCT solenoid, refer to Powertrain Control and Emissions Diagnosis (PC/ED) pinpoint test HK11 to cycle the affected VCT solenoid 10 times to attempt to clear the debris. For claiming, use causal part 6M280 and applicable labor operations in Section 10 of the Service Labor Time Standards (SLTS) Manual.