

SSM 48895 - 2017-2019 Escape - 1.5L/2.0L - Illuminated Malfunction Indicator Lamp (MIL) - Various DTCs - Fuse F34 Open

Some 2017-2019 Escape vehicles equipped with a 1.5L or 2.0L engine may exhibit fuse F34 open with an illuminated MIL and diagnostic trouble codes (DTCs) P0034, P023A, P0245, P0480, P0481, P0645, P06A0, P06DB, P188D, P02602, and/or P2681 in the powertrain control module (PCM). The vehicle may also exhibit an all-wheel drive (AWD) fault warning and/or illuminated traction control (TC) lamp. Inspect the 12A690 (1.5L) or 12C508 (2.0L) wiring harness from the battery junction box (BJB) to the PCM for wiring harness retainers not installed correctly allowing chafing to occur at multiple points. Repair damaged wiring as required. Refer to the Wiring Diagram for repair information. For claiming, use causal part 12A690 (1.5L) or 12C508 (2.0L) and applicable labor operations in Section 10 of the Service Labor Time Standards (SLTS) Manual.

APPLICABLE VEHICLES

2017 - 2019 TRUCK: M2 C520N ESCAPE

2017 - 2019 TRUCK: M2 C520N ESCAPE