

SSM 48958

2020 F-Super Duty - Illuminated MIL And/Or Wrench Light With DTCs P0715, P0716, P0717, P0718, P07BF And/Or P07C0

Text:

Some 2020 Super Duty vehicles equipped with an 10R140 automatic transmission may exhibit an illuminated malfunction indicator lamp (MIL) and/or wrench light with diagnostic trouble codes (DTCs) P0715, P0716, P0717, P0718, P07BF and/or P07C0 stored in the powertrain control module (PCM). If any of these DTCs are set, focus diagnostics on the turbine shaft speed sensor (TSS) and/or TSS circuits. Refer to Workshop Manual (WSM), Section 307-01. Replacement of the ISSA or ISSB sensor will not correct this condition.

Vehicles:

2020 F-Super Duty (P558) NA (FE)