

SSM 49197 - 2020 Explorer/Aviator/Police Interceptor Utility - Hybrid Engine - Illuminated MIL With DTCs P0217 And/Or P06EF - Built On Or Before 04-Aug-2020

Some 2020 Explorer/Aviator/Police Interceptor Utility vehicles equipped with a hybrid engine and built on or before 04-Aug-2020 may exhibit an illuminated malfunction indicator lamp (MIL) and/or engine overheating fault message with diagnostic trouble codes (DTCs) P0217 and/or P06EF stored in the powertrain control module (PCM). This may be due to an assembly pin left in the accessory drive belt tensioner during the production process. To correct the condition, remove any assembly pins from the accessory drive belt tensioner. If no pins are found, refer to Workshop Manual (WSM), Section 303-06 or Section 303-03 for further diagnostics.

APPLICABLE VEHICLES

2020 CAR: TV U611N AVIATOR

2020 CAR: TW U625N EXPLORER