

**SSM 49345 - 2020 Various Vehicles - 8F35/8F40 - Powertrain
Malfunction (Wrench) Indicator -DTCs P0741 And/Or P1744 - Built On
Or Before 30-Sep-2020**

Some 2020 Edge/Nautilus/Escape/Corsair/Transit Connect vehicles with and 8F35/8F40 transmission built on or before 30-Sep-2020 may exhibit an illuminated powertrain malfunction (wrench) indicator with diagnostic trouble codes (DTCs) P0741 and/or P1744 present or stored in the powertrain control module (PCM). This may be due to the torque converter and a pump stator bushing leak. Replacement of only the torque converter and/or the main control may not resolve the concern. To correct the condition, replace the following components: the torque converter, fluid pump assembly, both fluid filters, main control, input shaft, and flush the transmission cooling system.

APPLICABLE VEHICLES

2020 CAR: TF CX483N CORSAIR

2020 CAR: DQ CD539N EDGE

2020 CAR: TC CX482N ESCAPE

2020 CAR: D9 U540N MKX

2020 CAR: HC V408E TRANSIT CONNECT