

SSM 49441 - 2020-2021 F-Super Duty - Illuminated MIL And/Or Powertrain Malfunction (Wrench) Indicator Lamp With DTCs P0715, P0716, P0717, P0718, P07BF And/Or P07C0

Some 2020-2021 Super Duty vehicles equipped with an 10R140 automatic transmission may exhibit an illuminated malfunction indicator lamp (MIL) and/or powertrain malfunction (wrench) indicator lamp with diagnostic trouble codes (DTCs) P0715,P0716, P0717, P0718, P07BF and/or P07C0 stored in the powertrain control module(PCM). If any of these DTCs are set, focus diagnostics on the turbine shaft speed sensor (TSS) and/or TSS circuits. Refer to Workshop Manual (WSM), Section 307-01. Replacement of the ISSA or ISSB sensor will not correct this condition.

APPLICABLE VEHICLES
2020 - 2021 TRUCK: FE P558N SUPER DUTY