

## **SSM 49686: 2020-2021 F-Super Duty - 6.7L - Lack Of Power And/Or DTC P1548 When Operating In Snowy Conditions - Heavy Snow Environment Pre-Filter Service Kit**

Some 2020-2021 F-Super Duty vehicles equipped with a 6.7L engine may experience a lack of power due to snow packing of the engine air cleaner when operating in extremely snowy conditions. Diagnostic trouble code (DTC) P1548 may be present in the powertrain control module (PCM). A heavy snow environment pre-filter service kit (service part LC3Z-9K635-AA) is now available for use but is not a warrantable item. It is recommended that the service kit be removed at temperatures greater than 50°C (10°C) and reinstall in subsequent winter seasons in order to maintain optimal vehicle performance. The service kit instructions mention that air filter FA-2031 is required, however the heavy snow environment pre-filter service kit can be used with either engine air filter FA-1951, or FA-2031 once it is available.

### Vehicles:

2020-2021 F-Super Duty (P558) NA (FE)