

## **SSM 49726: 2016-2018 Focus, 2018-2019 EcoSport - 1.0L EcoBoost - 6F15 - Loss Of Engine Oil Pressure - Built On Or Before 3-Jul-2019**

Some 2016-2018 Focus and 2018-2019 EcoSport vehicles equipped with a 1.0L EcoBoost engine, 6F15 automatic transmission and built on or before 3-Jul-2019, may exhibit an illuminated oil pressure warning lamp with a loss of engine oil pressure. This may be due to a failed engine oil pump belt tensioner which leads to a loss of engine oil pressure. If engine oil pressure at idle is below 10 psi and/or metal contamination is present in the engine oil, no further diagnostics should be performed. Replace the engine assembly to correct this condition.

### Vehicles:

- 2018-2019 EcoSport B515 India (BW)
- 2016-2018 Focus C346 NA (DH)