

SSM 49843

Title:

2016-2018 Focus, 2018-2019 EcoSport - 1.0L EcoBoost - 6F15 - Loss Of Engine Oil Pressure - Built On Or Before 3-Jul-2019

Text:

Some 2016-2018 Focus and 2018-2019 EcoSport vehicles equipped with a 1.0L EcoBoost engine, 6F15 automatic transmission and built on or before 3-Jul-2019 may exhibit an illuminated oil pressure warning lamp with a loss of engine oil pressure. This may be due to a failed engine oil pump belt tensioner which leads to a loss of engine oil pressure. If engine oil pressure at idle is below 10 psi (refer to Section 303-00 in the Workshop Manual for the oil pressure test procedure) and/or metal contamination is present in the engine oil, no further diagnostics should be performed. Replace the engine assembly with a long block option 6006 to correct this condition.

Vehicles:

| | |
|-----------|--------------------------|
| 2018-2019 | EcoSport B515 India (BW) |
| 2016-2018 | Focus C346 NA (DH) |