

## **SSM 49895 –**

### **2021 Bronco - Parking Aid Fault Message Displayed In The Instrument Cluster - Equipped With Front And Rear Parking Aid Sensors**

Some 2021 Bronco vehicles equipped with front and rear parking aid sensors may set diagnostic trouble codes (DTCs) for all 8 parking aid sensors and/or circuits if 2 or more rear parking aid sensors and/or circuits have a fault. This is due to the software within the parking aid module (PAM). If the PAM sets DTCs for all 8 parking aid sensors and/or circuits, diagnose the rear parking aid sensor and circuit DTCs first. Reference Workshop Manual (WSM), Section 413-13A for all parking aid diagnostic information. An update to the PAM software will be available in August 2021. Monitor OASIS for updates.

APPLICABLE VEHICLES  
2021 TRUCK: G1 U725N BRONCO