

## **SSM 50171 - 2019-2021 Edge/Nautilus/Ranger, 2020-2021 Escape/Corsair/Explorer, 2021 Bronco Sport - 2.0L/2.3L EcoBoost - Lack Of Power With Illuminated MIL - Various DTCs**

Some 2019-2021 Edge/Nautilus/Ranger, 2020-2021 Escape/Corsair/Explorer, and 2021 Bronco Sport vehicles equipped with a 2.0L/2.3L EcoBoost may exhibit a lack of power with an illuminated malfunction indicator lamp (MIL) with diagnostic trouble codes (DTC) P02AB, P0243, P0299, P1464, P25B3, P25B4, P2AB7, P2AB8 and/or P2AB9. This may be due to an inoperative wastegate actuator, missing wastegate actuator e-clip or non-visible damage to the actuator rod. A lower level service component has been released, K2GZ-9G488-B for Edge/Nautilus/Escape/Corsair/Bronco Sport vehicles and LB5Z-9G488-B for Explorer/Ranger vehicles, for service to replace the actuator, actuator rod and both e-clips. When replacing the wastegate actuator, it is important to replace all parts in the service kit. Turbocharger replacement is not necessary to correct the condition.

### APPLICABLE VEHICLES

2020 - 2021 CAR: TF CX483N CORSAIR  
2020 - 2021 CAR: TF CX483N CORSAIR  
2020 - 2021 CAR: TW U625N EXPLORER  
2019 - 2021 CAR: DQ CD539N EDGE  
2020 - 2021 CAR: TC CX482N ESCAPE  
2019 - 2021 CAR: D9 U540N MKX  
2019 - 2021 TRUCK: FG P375N RANGER  
2021 CAR: HD CX430N C-SUV