

## **SSM 50193 - 2020-2021 Aviator, 2021 Corsair Hybrid - Charging Concerns With The Lincoln Dual-Voltage Charging Cord**

Some 2020-2021 Aviator and 2021 Corsair hybrid vehicles may exhibit charging concerns with the Lincoln Dual-Voltage Charging Cord. Use a 110/120V non-GFI outlet and check to see if the vehicle charges properly with the 220V adapter removed. If the charging cord concern is only present when using the 220V adapter, a complete charge cord replacement may not be needed as the 220V adapter (part number VL5CZ-10B706-B) is available separately at [accessories.lincoln.com](https://accessories.lincoln.com) or through the local Ford Authorized Distributor (FAD). Note that discoloration of the 220V adapter or dual voltage charging cord could indicate a problem with the electrical outlet that's used and should be inspected by a licensed electrician. For further diagnostic assistance, contact Webasto Charging systems, Inc. directly at 888-219-6747 or at [evscs@webasto.com](mailto:evscs@webasto.com).

### APPLICABLE VEHICLES

2021 CAR: TF CX483N CORSAIR

2020 - 2021 CAR: TV U611N AVIATOR