

SSM 50248 - 2021 Corsair/Escape - 2.0L/2.3L Engine - Rattle/Buzz Noise On Start-Up/Idle/Slow Speed From The Back Of The Engine Compartment Area - Built On Or After 04-Jan-2021

Some 2021 Corsair/Escape vehicles equipped with 2.0L or 2.3L engines and built on or after 04-Jan-2021 may exhibit a rattle/buzz noise on start-up/idle/slow speed from the back of the engine compartment area. This noise may be caused by fuel line heat shield contact with the fuel/brake lines at the rear engine compartment. The fuel line heat shield is located on the front dash cross member. Adjust from the bottom of the heat shield 10° forward or 15 mm (0.6 inches) clearance between the shield and the fuel/brake lines.

APPLICABLE VEHICLES

2021 CAR: TC CX482N ESCAPE

2021 CAR: TC CX482N ESCAPE

2021 CAR: TF CX483N CORSAIR

2021 CAR: TF CX483N CORSAIR