

## **SSM 50564 - 2020-2022 F-Super Duty – 6.7L – Turbocharger Variable Vane Actuator Available For Service**

Some 2020-2022 F-Super Duty vehicles equipped with a 6.7L engine may exhibit an illuminated malfunction indicator lamp (MIL), lack of power, and/or excessive turbo noise during operation, with diagnostic trouble codes (DTC) P003A, P0045, P0046, P0047, P0048, P0234, P0237, P0238, P132A, P2564, P2565, P2598, P259E, and/or P259F stored in the powertrain control module. If Workshop Manual (WSM) diagnostics lead to turbocharger variable vane actuator replacement, service part LC3Z-9G488-A has been released for service. Replacement of the turbocharger assembly is no longer required.

APPLICABLE VEHICLES  
2020 - 2022 TRUCK: FE P558N SUPER DUTY